

AD-A144 985


NATIONAL PROGRAM FOR INSPECTION OF NON-FEDERAL DAMS  
CASE POND UPPER DAM (U) CORPS OF ENGINEERS WALTHAM  
MA NEW ENGLAND DIV MAY 88


1/1

UNCLASSIFIED

F/G 13/13

NL

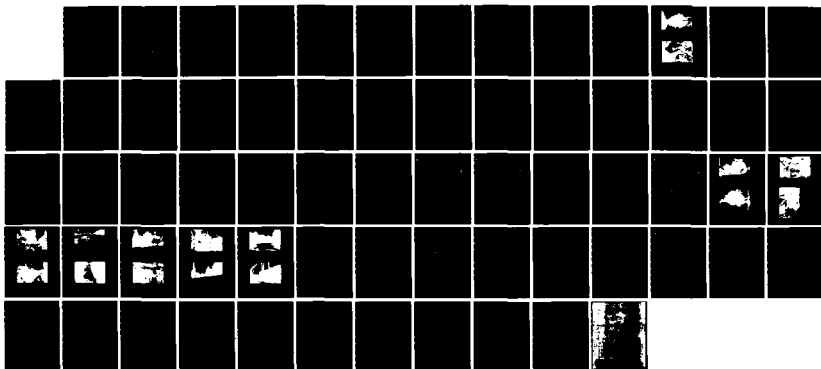

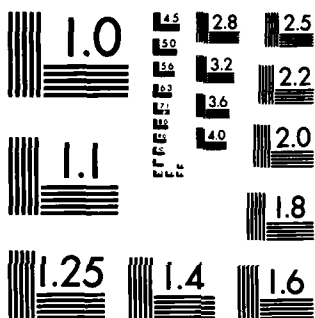

MICROCOPY RESOLUTION TEST CHART  
NATIONAL BUREAU OF STANDARDS-1963-A

AD-A144 985

HOCKANUM RIVER BASIN  
MANCHESTER, CONNECTICUT

CASE POND UPPER DAM  
CT 00560

PHASE I INSPECTION REPORT  
NATIONAL DAM INSPECTION PROGRAM



DTIC  
ELE

AUG 20 1984

DEPARTMENT OF THE ARMY  
NEW ENGLAND DIVISION, CORPS OF ENGINEERS  
WALTHAM, MASS. 02154

MAY 1980

This document has been approved  
for public release and sale its  
distribution is unlimited.

84 08 20 C27

DTIC FILE COPY

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER CT 00560	2. GOVT ACCESSION NO. AD-A144985	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle) Case Pond Upper Dam  NATIONAL PROGRAM FOR INSPECTION OF NON-FEDERAL DAMS		5. TYPE OF REPORT & PERIOD COVERED INSPECTION REPORT
7. AUTHOR(s) U.S. ARMY CORPS OF ENGINEERS NEW ENGLAND DIVISION		6. PERFORMING ORG. REPORT NUMBER
9. PERFORMING ORGANIZATION NAME AND ADDRESS		8. CONTRACT OR GRANT NUMBER(s)
11. CONTROLLING OFFICE NAME AND ADDRESS DEPT. OF THE ARMY, CORPS OF ENGINEERS NEW ENGLAND DIVISION, NEDED 424 TRAPELO ROAD, WALTHAM, MA. 02254		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)		12. REPORT DATE May 1980
		13. NUMBER OF PAGES 65
		15. SECURITY CLASS. (of this report)  UNCLASSIFIED
		16a. DECLASSIFICATION/DOWNGRADING SCHEDULE
16. DISTRIBUTION STATEMENT (of this Report)  APPROVAL FOR PUBLIC RELEASE: DISTRIBUTION UNLIMITED		
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)		
18. SUPPLEMENTARY NOTES Cover program reads: Phase I Inspection Report, National Dam Inspection Program; however, the official title of the program is: National Program for Inspection of Non-Federal Dams; use cover date for date of report.		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number) DAMS, INSPECTION, DAM SAFETY, Hockanum River Basin Manchester, Connecticut		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) Case Pond Upper Dam is a 110-year old earth embankment, with an approximate length of 300 feet and a maximum height of 16 feet. The spillway is 87 feet long with a crest elevation about 2 feet below the top of the dam. The dam appears to be in poor condition. The maximum storage capacity of 52 acre-feet along with the maximum height of 16 feet place the dam in the "Small" size category. The dam is classified as "Significant" hazard potential. The recommended test flood ranges from the 100-year flood to one-half of the PMF.		

CASE POND UPPER DAM

CT 00560

HOCKANUM RIVER BASIN  
MANCHESTER, CONNECTICUT

PHASE I INSPECTION REPORT  
NATIONAL DAM INSPECTION PROGRAM

DTIC  
ELECTE  
AUG 20 1984

A

A-1

# NATIONAL DAM INSPECTION PROGRAM

## PHASE I INSPECTION REPORT



Identification No.: CT 00560  
Name of Dam: Case Pond Upper Dam  
City: Manchester  
County and State: Hartford County, Connecticut  
Stream: Birch Mountain Brook  
Date of Inspection: November 14, 1979

DTIC  
COPY  
A-1

### BRIEF ASSESSMENT

Case Pond Upper Dam is a 110-year old earth embankment, used to impound water of the Birch Mountain Brook for recreational purposes. The dam is irregularly shaped in plan and section with an approximate length of 300 feet and a maximum height of 16 feet. The spillway is 87 feet long with a crest elevation about 2 feet below the top of the dam.

The drainage area for Case Pond Upper Dam is approximately 1.6 square miles. The maximum storage capacity of 52 acre-feet along with the maximum height of 16 feet place the dam in the "Small" size category. A breach of the dam could cause appreciable damage to a highway bridge located approximately 600 feet downstream of the dam, but it is unlikely that any lives would be lost. Therefore, the dam is classified in the "Significant" hazard potential category. The recommended test flood for a "Small" size, "Significant" hazard dam ranges from the 100-year flood to one-half of the Probable Maximum Flood (PMF). The selected test flood for this structure is one-half of the PMF.

The peak test flood inflow for Case Pond Upper Dam is 1,470 cfs. The routed test flood outflow of 1,460 cfs overtops the dam by 0.5 feet. The spillway is capable of discharging 810 cfs, or about 56 percent of the routed test flood outflow, prior to overtopping of the dam. A breach of the dam would result in a 3.1-foot depth (contained within the channel banks) of flow at the first residential area (an apartment complex), located about 4,400 feet downstream of the dam.

The dam appears to be in poor condition. Many trees, with trunks up to 3 feet in diameter, are growing on both the upstream and downstream faces of the dam as well as on the crest. No erosion protection is provided on the upstream face. Seepage (about 2 gpm) was observed during the inspection about 10 feet downstream of the dam. No emergency low level outlet exists for drawing down the impoundment.

AUG 29 1984

Within one year after receipt of this Phase I Inspection Report, the Owners should retain the services of a qualified, registered professional engineer, experienced in the design and construction of dams to: 1) investigate the cause of the seepage located in the vicinity of the downstream toe of the embankment and assess the need for remedial action; 2) direct the removal of trees and root systems from the dam and within a 20-foot wide area surrounding the dam; 3) design a low level outlet for emergency drawdown of the pond; and 4) investigate the abandoned 12-inch diameter pipe to insure that the pipe is not under pressure through the embankment.

In addition, the Owners should perform the following operation and maintenance work: 1) install riprap or other means of protecting the upstream face of the dam; 2) repair all deteriorated concrete and masonry surfaces; 3) repair the cracks between the spillway wall and the rock foundation; 4) develop and implement an ongoing operation and maintenance program; 5) initiate a program of annual technical inspection; and 6) develop a flood warning plan so that downstream residents will be notified in the event of possible overtopping and/or failure of the dam.

O'BRIEN & GERE ENGINEERS, INC.

  
John J. Williams  
Vice President  
New York Registration No. 050794



Date 16 May 1980

## PREFACE

This report is prepared under guidance contained in the Recommended Guidelines for Safety Inspection of Dams, for Phase I Investigations. Copies of these guidelines may be obtained from the Office of Chief of Engineers, Washington, D.C. 20314. The purpose of a Phase I Investigation is to identify expeditiously those dams which may pose hazards to human life or property. The assessment of the general condition of the dam is based upon available data and visual inspections. Detailed investigation, and analyses involving topographic mapping, subsurface investigations, testing, and detailed computational evaluations are beyond the scope of a Phase I investigation: however, the investigation is intended to identify any need for such studies.

In reviewing this report, it should be realized that the reported condition of the dam is based on observations of field conditions at the time of inspection along with data available to the inspection team. In cases where the reservoir was lowered or drained prior to inspection, such action, while improving the stability and safety of the dam, removes the normal load on the structure and may obscure certain conditions which might otherwise be detectable if inspected under the normal operating environment of the structure.

It is important to note that the condition of a dam depends on numerous and constantly changing internal and external conditions, and is evolutionary in nature. It would be incorrect to assume that the present condition of the dam will continue to represent the condition of the dam at some point in the future. Only through continued care and inspection can there be any chance that unsafe conditions be detected.

Phase I inspections are not intended to provide detailed hydrologic and hydraulic analyses. In accordance with the established Guidelines, the Spillway Test flood is based on the estimated "Probable Maximum Flood" for the region (greatest reasonably possible storm runoff), or fractions thereof. Because of the magnitude and rarity of such a storm event, a finding that a spillway will not pass the test flood should not be interpreted as necessarily posing a highly inadequate condition. The test flood provides a measure of relative spillway capacity and serves as an aid in determining the need for more detailed hydrologic and hydraulic studies, considering the size of the dam, its general condition and the downstream damage potential.

The Phase I Investigation does not include an assessment of the need for fences, gates, no-trespassing signs, repairs to existing fences and railings and other items which may be needed to minimize trespass and provide greater security for the facility and safety to the public. An evaluation of the project for compliance with OSHA rules and regulations is also excluded.



## TABLE OF CONTENTS

<u>SECTION</u>	<u>PAGE</u>
Letter of Transmittal	
Brief Assessment	
Review Board Page	
Preface	i
Table of Contents	ii-iv
Overview Photo	v
Location Map	vi

## REPORT

I. PROJECT INFORMATION	1-1
1.1 General	1-1
a. Authority	1-1
b. Purpose of Inspection	1-1
1.2 Description of Project	1-1
a. Location	1-1
b. Description of Dam and Appurtenances	1-2
c. Size Classification	1-2
d. Hazard Classification	1-3
e. Ownership	1-3
f. Operator	1-3
g. Purpose of Dam	1-3
h. Design and Construction History	1-3
i. Normal Operating Procedures	1-3
1.3 Pertinent Data	1-4
a. Drainage Area	1-4
b. Discharge at Damsite	1-4
c. Elevation	1-5
d. Reservoir Length	1-5
e. Storage	1-5
f. Reservoir Surface Area	1-6
g. Dam Data	1-6
h. Diversion and Regulating Tunnel	1-6
i. Spillways	1-6
j. Regulating Outlets	1-6

## TABLE OF CONTENTS (Con't)


<u>SECTION</u>	<u>PAGE</u>
2. ENGINEERING DATA	
2.1 Design	2-1
2.2 Construction	2-1
2.3 Operation	2-1
2.4 Evaluation	2-1
a. Availability	2-1
b. Adequacy	2-1
c. Validity	2-1
3. VISUAL INSPECTION	
3.1 Findings	3-1
a. General	3-1
b. Dam	3-1
c. Appurtenant Structures	3-1
d. Reservoir Area	3-2
e. Downstream Channel	3-2
3.2 Evaluation	3-2
4. OPERATIONAL AND MAINTENANCE PROCEDURES	
4.1 Operational Procedures	4-1
a. General	4-1
b. Description of Any Warning System in Effect	4-1
4.2 Maintenance Procedures	4-1
a. General	4-1
b. Operating Facilities	4-1
4.3 Evaluation	4-2
5. EVALUATION OF HYDRAULIC/HYDROLOGIC FEATURES	
5.1 General	5-1
5.2 Design Data	5-1
5.3 Experience Data	5-1
5.4 Test Flood Analysis	5-1
5.5 Dam Failure Analysis	5-2

## TABLE OF CONTENTS (Con't)

<u>SECTION</u>	<u>PAGE</u>
6. EVALUATION OF STRUCTURAL STABILITY	
6.1 Visual Observation	6-1
6.2 Design and Construction Data	6-1
6.3 Post-Construction Data	6-1
6.4 Seismic Stability	6-1
7. ASSESSMENT, RECOMMENDATIONS AND REMEDIAL MEASURES	
7.1 Dam Assessment	7-1
a. Condition	7-1
b. Adequacy of Information	7-1
c. Urgency	7-1
7.2 Recommendations	7-1
7.3 Remedial Measures	7-1
a. Operation and Maintenance Procedures	7-1
7.4 Alternatives	7-2

## APPENDICES


APPENDIX A - INSPECTION CHECKLIST	A-1 to A-5
APPENDIX B - ENGINEERING DATA	B-1 to B-2
APPENDIX C - PHOTOGRAPHS	C-1 to C-7
APPENDIX D - HYDROLOGIC AND HYDRAULIC COMPUTATIONS	D-1 to D-16
APPENDIX E - INFORMATION AS CONTAINED IN THE NATIONAL INVENTORY OF DAMS	

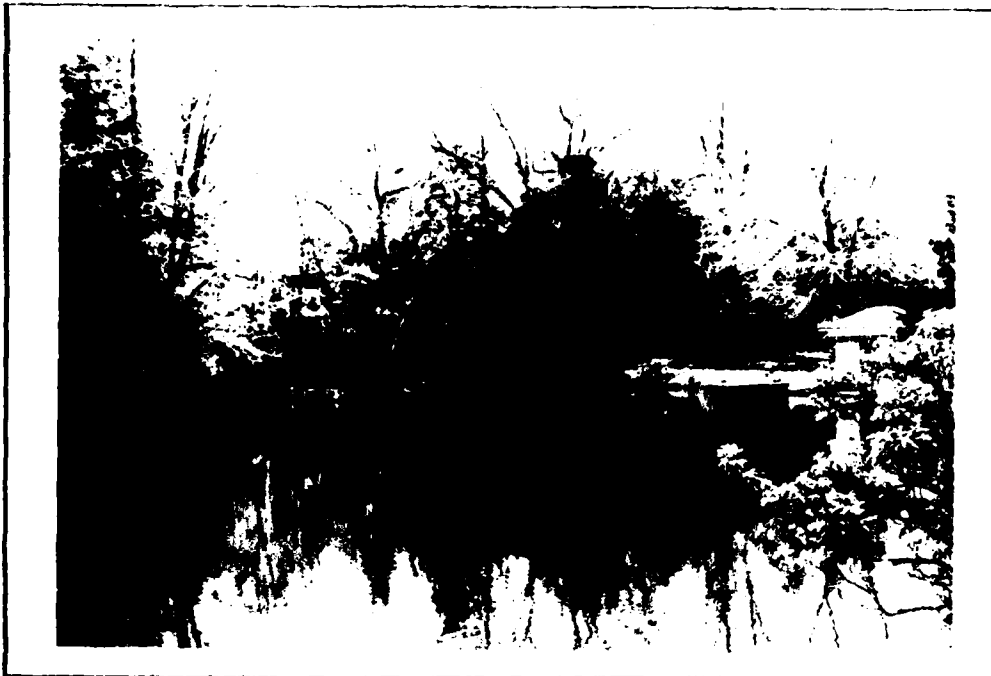

UPSTREAM OVERVIEW OF THE DAM WITH THE TREE COVERED EMBANKMENT TO THE LEFT. (11/14/79)



DOWNSTREAM OVERVIEW AS OBSERVED FROM THE RIGHT ABUTMENT. (11/14/79)

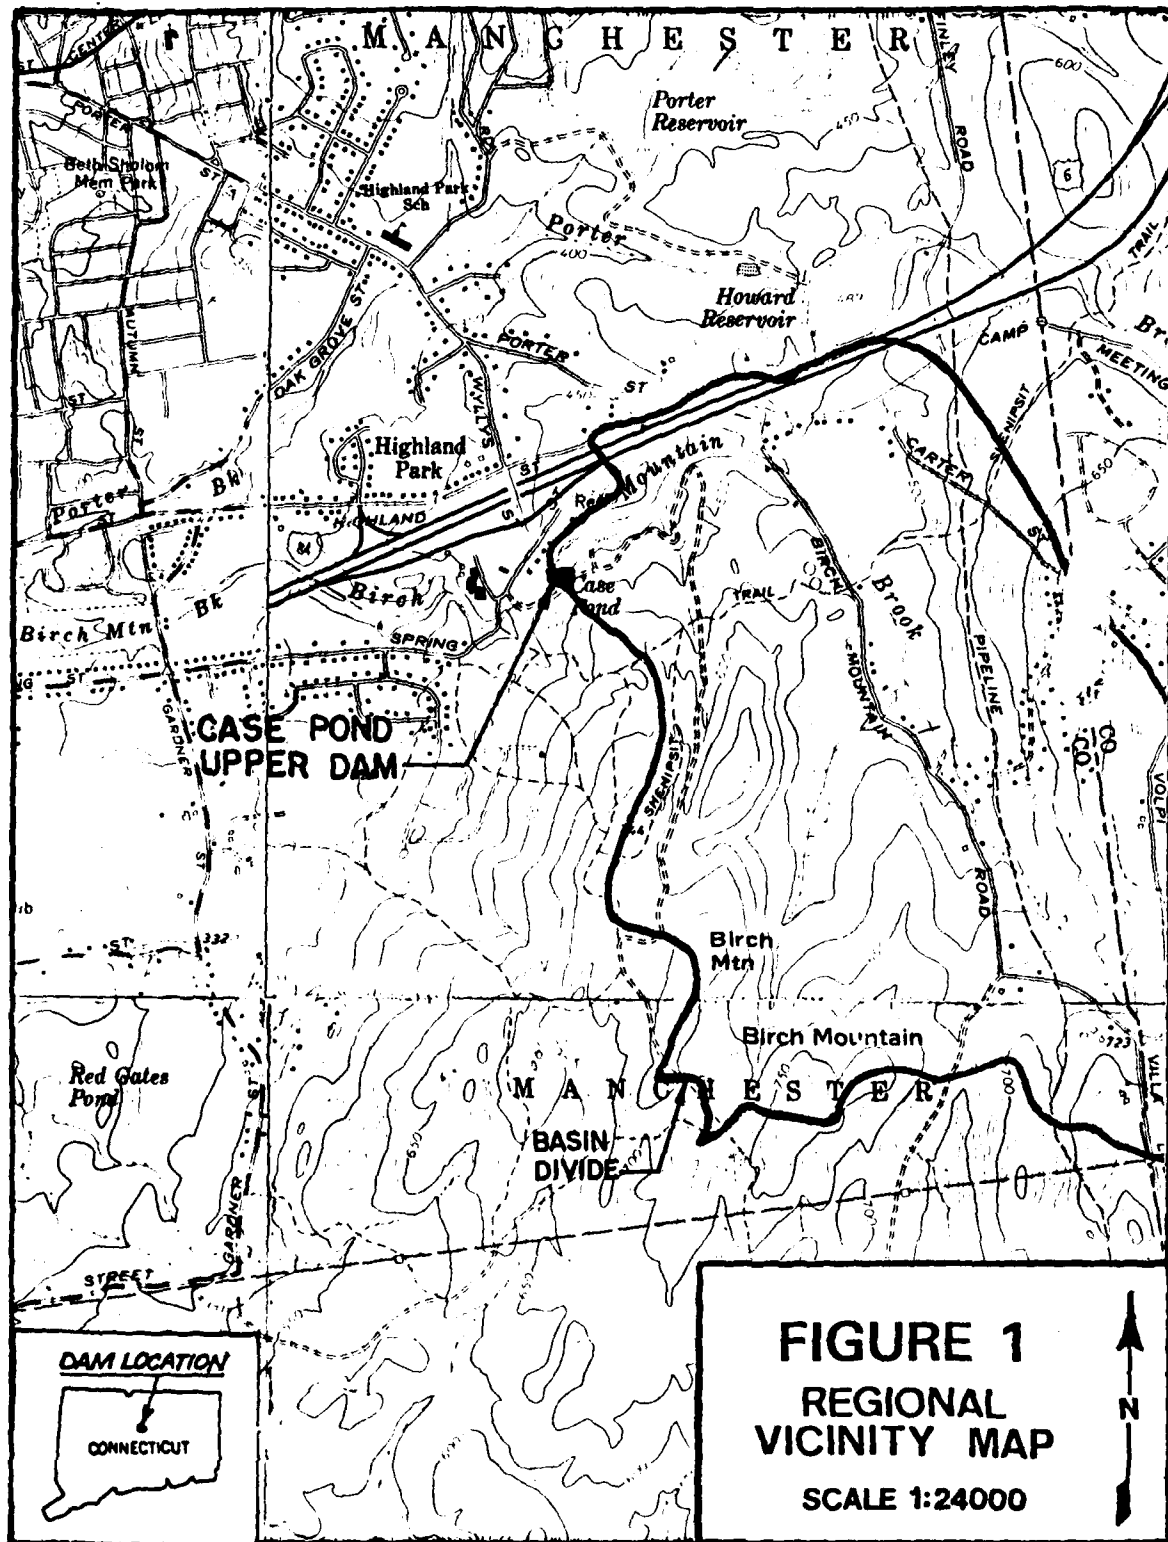

NATIONAL DAM INSPECTION PROGRAM  
PHASE I INSPECTION REPORT  
CASE POND UPPER DAM

SECTION 1

PROJECT INFORMATION

1.1 General

a. Authority. The National Dam Inspection Act (Public Law 92-367) was passed by Congress on August 8, 1972. Under this Act, the Secretary of the Army was authorized to initiate, through the Corps of Engineers, the National Program for Inspection of Dams throughout the United States. Responsibility for supervising inspection of dams in the New England Region has been assigned to the New England Division of the Corps of Engineers.

O'Brien & Gere Engineers, Inc. has been retained by the New England Division to inspect and report on selected non-federal dams in the State of Connecticut. Authorization and Notice to Proceed were issued to O'Brien & Gere by a letter dated November 6, 1979 and signed by Col. William E. Hodgson, Jr. Contract No. DACW33-80-C-0014 has been assigned by the Corps of Engineers for this work.

b. Purpose. The purpose of inspecting and evaluating non-federal dams is to:

1. Identify conditions which threaten public safety and make the Owner aware of any deficiencies so that he may correct them in a timely manner.

2. Encourage and prepare the states to initiate an effective dam safety program for non-federal dams as soon as possible.

3. Update, verify and complete the National Inventory of Dams.

1.2 Description of Project (information with regard to this dam was obtained from Mr. Robert C. Dennison, co-Owner of Case Pond Upper Dam)

a. Location. Case Pond Upper Dam is located on Birch Mountain Brook in the southeastern corner of the City of Manchester, Connecticut. The dam is shown on the USGS Quadrangle entitled "Manchester, Conn." at coordinates N41°45.7; W72°29.3'. A regional location plan of Case Pond Upper Dam is enclosed as Figure 1 on page vi.

Birch Mountain Brook merges with Porter Brook to form Hop Brook about 1.5 miles west of the damsite. Hop Brook continues westward for approximately four miles where it joins the Hockanum River at Laurel Lake.

The potential damage area is the highway bridge located about 600 feet downstream of Case Pond Upper Dam. The initial residential area is an apartment complex located approximately 4,400 feet downstream of the dam.

b. Description of Dam and Appurtenances. Case Pond Upper Dam is an irregular earth embankment with an approximate length of 300 feet and a maximum height of about 16 feet with a variable crest width ranging from 15 feet to 65 feet. The unprotected upstream face of the dam is on a slope of about 1H:1V. The downstream face of the dam is partially retained by a vertical stone masonry wall about 100 feet long and 16 feet high. The remainder of the downstream face of the dam is on a slope which averages 2H:1V.

The concrete spillway located between the embankment and right abutment is 87 feet long. The downstream face of the spillway which extends a maximum of three feet above the irregular bedrock foundation, is vertical. The spillway is supported by four small concrete buttresses on the downstream side of the spillway. The spillway section has been integrated into three pre-existing stone masonry piers which supported a pedestrian bridge removed years ago.

c. Size Classification. Case Pond Upper Dam has a maximum height of approximately 16 feet and a maximum storage capacity of 52 acre-feet. The criteria for the "Small" size category includes dams which have less than 1,000 acre-feet of storage capacity and are less than 40 feet high. Therefore, Case Pond Upper Dam is classified as a "Small" size structure.

d. Hazard Classification. The potential damage area is considered to be a highway bridge (Spring St.) located approximately 600 feet downstream of the dam. Breach flows would travel through Case Pond Lower Dam then down a steep incline to the Spring Street Bridge. The first residential area is an apartment complex located about 4,400 feet downstream of the dam. The failure analysis indicated that breach floodwaters would be contained within the channel banks at this location. A failure of the dam could result in appreciable damage to the highway bridge, but it is unlikely that lives would be lost at any downstream location. Therefore, Case Pond Upper Dam is classified in the "Significant" hazard potential category.

e. Ownership. The co-Owners for Case Pond Upper Dam are:

Mr. Robert C. Dennison  
700 Spring Street  
Manchester, Connecticut 06040  
Telephone: 203-643-4986

Mr. Andrew Ansaldi  
81 Battista Road  
Manchester, Connecticut 06040  
Telephone: 203-649-5249

f. Operator. The dam is not equipped with any operating facilities other than an inoperable valve on an abandoned 12-inch diameter pipe which was used to provide water for a nearby mill. The Owners would perform any operations associated with the dam.

g. Purpose of Dam. The dam currently impounds water for recreational purposes.

h. Design and Construction History. The dam was originally built about 1870. Since that time, the spillway has been revised three times; in 1880, the masonry portion of the spillway wall was built; in 1890, the present spillway was constructed; and in 1962, the spillway was repaired.

i. Normal Operating Procedures. There are no operating procedures for this site.

### 1.3 Pertinent Data

a. Drainage Area. A 1.6 square mile watershed, ranging from Elevation 785 at Birch Mountain to Elevation 448 at normal pool, drains to Case Pond Upper Dam. The area is primarily forested with some upstream residential development.

b. Discharge at Damsite.

1. Outlet Works. The only known outlet is an abandoned 12-inch diameter valve and pipe which used to provide water for a nearby mill. According to Mr. Dennison, the valve has been inoperable for at least 10 years.

2. Maximum Known Flood. According to Mr. Dennison, the embankment was overtopped in September, 1938, but he does not recall the depth of overtopping. Details associated with this event, as it related to Case Pond Upper Dam, are not recorded.

3. Ungated Spillway Capacity at Top of Dam. The capacity of the spillway at the top of dam Elevation 450.0, is approximately 812 cfs.

4. Ungated Spillway Capacity at Test Flood Elevation. At the test flood Elevation 450.5, the spillway capacity is 1,134 cfs.

5. Gated Spillway Capacity at Top of Dam. Not Applicable.

6. Gated Spillway Capacity at Test Flood Elevation. Not Applicable.

7. Total Spillway Capacity at Test Flood Elevation. (See 4 above)

8. Total Project Discharge at Top of Dam. The total project discharge, with the pool elevation at the top of dam Elevation 450.0, is estimated to be 812 cfs.

9. Total Project Discharge at Test Flood Elevation. The total project discharge at the test flood Elevation 450.5 is estimated to be 1,458 cfs.

c. Elevation. (NGVD)

1. Streambed at Toe of Dam	434 <sup>+</sup>
2. Bottom of Cutoff	Unknown
3. Maximum Tailwater	Unknown
4. Recreation Pool	448
5. Full Flood Control Pool	N/A
6. Spillway Crest (Ungated)	448
7. Design Surge (Original Design)	Unknown
8. Top of Dam	450
9. Test Flood Surge	450.5



d. Reservoir Length. (Feet)

1. Normal Pool	1,800
2. Flood Control Pool	N/A
3. Spillway Crest Pool	1,800
4. Top of Dam Pool	3,100
5. Test Flood Pool	3,200

e. Storage. (Acre-Feet)

1. Normal Pool	30
2. Flood Control Pool	N/A
3. Spillway Crest Pool	30
4. Top of Dam Pool	52
5. Test Flood Pool	61

f. Reservoir Surface Area. (Acres)

1. Normal Pool	6.0
2. Flood Control Pool	N/A
3. Spillway Crest Pool	6.0
4. Top of Dam Pool	17.5
5. Test Flood Pool	19.0

g. Dam Data.

1. Type	Earth Embankment
2. Length	300 feet
3. Height	16 feet
4. Top Width	Variable, 15 feet to 65 feet
5. Side Slopes (Upstream)	1H:1V
(Downstream)	2H:1V
6. Zoning	Unknown
7. Impervious Core	Unknown
8. Cutoff	Unknown
9. Grout Curtain	Unknown

h. Diversion and Regulating Tunnel.

Not Applicable

i. Spillway.

1. Type	Concrete Overflow
2. Length of Weir	87 feet
3. Crest Elevation	448
4. Gates	None
5. Upstream channel	Case Pond Upper
6. Downstream Channel	Case Pond Lower and steep rock gorge

j. Regulating Outlet.

1. Invert Elevation
2. Size
3. Description
4. Control Mechanism
5. Other

435<sup>+</sup>  
12-inch diameter  
Cast Iron Pipe  
Gate Valve (Inoperable)  
Abandoned Outlet

## SECTION 2

### ENGINEERING DATA

#### 2.1 Design

According to the co-Owners, there is no design information available.

#### 2.2 Construction

No construction information exists except for knowledge of approximate construction dates. The dam was originally constructed in about 1870 and since that time, modifications have been made to the spillway (see Section 1.2-h).

#### 2.3 Operation

Other than the abandoned 12-inch diameter outlet, which was used to convey water to a nearby mill, there are no operating facilities at this site.

#### 2.4 Evaluation

a. Availability. There is no information available with respect to the design and construction of the Case Pond Upper Dam.

b. Adequacy. Although no drawings or engineering information with respect to Case Pond Upper Dam is available, it is believed that sufficient information has been obtained during the field inspection and through conversations with the Owners, to conduct a Phase I dam evaluation.

c. Validity. There is no reason to question the validity of the information obtained from the Owners.

## SECTION 3

### VISUAL INSPECTION

#### 3.1 Findings

a. General. Case Pond Upper Dam was inspected on November 14, 1979. At the time of inspection, the pool elevation was approximately at the spillway crest (Elevation 488.0). Underwater areas were not inspected.

A checklist of observations and comments made during the inspection is included as Appendix A.

b. Dam. The dam is an earth embankment partially retained on the downstream slope by a vertical stone masonry wall in the vicinity of the left abutment. It is irregular in plan and section and is almost completely obscured by large trees and brush growing on the dam. The following conditions were observed during the field inspection:

1. The unprotected upstream face of the embankment is on a slope of 1H:1V and there is evidence of some erosion at several locations.

2. The dam crest to the left of the spillway is almost completely overgrown with large trees and brush. A few of the trees have trunk diameters of at least three feet. The larger trees range up to 50 feet in height. No evidence of settlement, cracks, or other indication of surface deficiency, was observed.

3. About 100 feet of the downstream face of the dam, towards the left abutment, is retained by a vertical 16-foot high stone masonry wall. The wall appears to be in fair condition with some loss of mortar, but no evidence of leakage through the wall or vertical or horizontal misalignments were observed. Rust-colored seepage, with a flow estimated to be about two gallons per minute, was observed in the old streambed about 10 feet downstream of the retaining wall (Page C-4). The soil in the area of the seepage is very soft. According to Mr. Dennison, this condition has remained unchanged for many years.

4. The downstream face of the dam, between the retaining wall and spillway, is on a slope which averages about 2H:1V with some portions as steep as 1H:1V. The surface is heavily overgrown with brush and large trees. The seepage described above has created minor sloughing and erosion of the slope in the vicinity of the toe.

Several photos of the conditions described above are included in Appendix C.

c. Appurtenant Structures. The spillway consists of a concrete wall, approximately three feet high and 87 feet long. The concrete generally appears to be in fair condition except for some spalling along the downstream face of the wall. In addition, some leakage was observed at the base of the wall near the right abutment.

The valve house is in fair condition. The valve on the 12-inch diameter outlet pipe has not been operable for at least 10 years. The 12-inch diameter outlet pipe also has not been used for at least 10 years.

d. Reservoir Area. The area bordering the pond is well vegetated but indications of erosion were observed on the banks. According to the Owners, the pond has appreciable sediment accumulation. They do not believe that the water is any more than 6 feet deep at any point in the impoundment.

e. Downstream Channel. The channel immediately downstream of the spillway is formed by an outcropping of bedrock. Water flowing over the spillway discharges down the bedrock and into Case Pond Lower. The dam for Case Pond Lower is a stone masonry structure with a stone masonry bridge built on its crest. The gradient of Birch Mountain Brook for about 4,000 feet downstream of Case Pond Lower Dam is relatively steep. The stream channel drops about 170 feet in this reach. The stream channel is overgrown with trees and brush but, due to the slope, the flow of water is not significantly impeded.

An estimated 1.5 miles downstream of Case Pond Upper Dam, Birch Mountain Brook joins Porter Brook to form Hop Brook. Hop Brook continues westward for approximately 4 miles where it joins the Hockanum River at Laurel Lake. Beyond the initial 4,000 feet downstream of Case Pond Upper Dam, the stream channel is on an estimated gradient of 0.4 percent with few obstructions aside from numerous bridges.

### 3.2 Evaluation

The dam is considered to be in poor condition. All of the trees and brush, especially the large trees, should be removed from the embankment crest and both the upstream and downstream faces. Erosion protection should be provided for the upstream face of the dam. The seepage condition and the necessity for a low-level outlet should be investigated.

## SECTION 4

### OPERATION AND MAINTENANCE PROCEDURES

#### 4.1 Operational Procedures

a. General. Since there are no operating facilities currently in use at the site, there is no designated operator. However, co-Owner Mr. Dennison, lives close to the dam and is familiar with past operation of the abandoned outlet, which used to furnish water to a nearby mill. According to Mr. Dennison, the outlet has been inoperable for at least 10 years.

b. Description of Any Warning System in Effect. According to Mr. Dennison, there is no formal warning system which would alert downstream property owners of an impending dam failure.

#### 4.2 Maintenance Procedures

a. General. According to Mr. Dennison, no maintenance has been performed on the dam for several years.

b. Operating Facilities. According to Mr. Dennison, the 12-inch diameter outlet has been inoperable for at least 10 years.

#### 4.3 Evaluation

The lack of an operation and maintenance program is reflected by conditions observed at the dam. A program should be established which would include periodic removal of vegetation from the dam, and repair of structural and operational elements of the dam.

## SECTION 5

### EVALUATION OF HYDRAULIC/HYDROLOGIC FEATURES

#### 5.1 General

The 1.6 square-mile area draining to Case Pond Upper Dam consists primarily of steep, forested terrain with some residential development. Topography within the watershed ranges from Elevation 785 at Birch Mountain to Elevation 448 at normal pool.

#### 5.2 Design Data

Hydraulic and hydrologic data used for the design of Case Pond Upper Dam are not available, according to the Owners.

#### 5.3 Experience Data

According to Mr. Dennison, the embankment was overtopped in September 1938, but he does not recall the depth of the overtopping. Details associated with this event, as it relates to Case Pond Upper Dam, are not recorded.

#### 5.4 Test Flood Analysis

The recommended test flood range for a "Small" size, "Significant" hazard dam is from the 100-year flood to one-half of the Probable Maximum Flood (PMF). Based upon the potential for appreciable damage to the downstream highway bridge, one-half of the PMF has been selected as the test flood.

Hydraulic and hydrologic calculations were performed with the assistance of the HEC-1-DB computer program. The flood hydrographs were constructed from Snyder unit hydrographs using average coefficients, an initial infiltration of zero, and a constant loss rate of 0.05 inches per hour. The Hop Brook Adjustment Factor was used to reduce the Probable Maximum Precipitation (PMP) based on the drainage area.

Stage vs. discharge and stage vs. storage relationships were developed for Case Pond Upper Dam for routing of the test flood through the pond and to the downstream flood impact area. The water surface elevation for Case Pond Upper was assumed to be at the spillway crest elevation at the beginning of the hypothetical storm event.

The test flood peak inflow to Case Pond Upper Dam was computed as 1,470 cfs. The routed test flood outflow of 1,460 cfs corresponds to a stage elevation of approximately 450.5 or 0.5 feet above the top of the dam. The spillway is capable of discharging 810 cfs or about 56 percent of the routed test flood outflow prior to overtopping of the dam.

### 5.5 Dam Failure Analysis

Failure of Case Pond Upper Dam was simulated through the use of the HEC-1-DB computer program. It was assumed that a 75-foot wide by 15-foot deep breach with vertical side slopes would develop over a two-hour period. Furthermore, failure was assumed to occur with the pool elevation at the top of the dam.

The maximum breach discharge of 812 cfs was routed to the initial residential area which consists of an apartment complex located about 4,400 feet downstream of the dam. The analysis indicates that the depth of flow in the stream channel would increase from about 0.5 feet to 3.1 feet and would remain within the channel banks.

However, the breach outflow could cause appreciable damage to a highway bridge (Spring St.) located across the channel approximately 600 feet downstream of the dam. Since no residential areas would be endangered by a breach flood, the highway bridge is considered to be the flood impact area.



## SECTION 6

### EVALUATION OF STRUCTURAL STABILITY

#### 6.1 Visual Observations

The roots of large trees growing on the embankment may be providing seepage paths through the dam and could be dislodging joint material from the downstream masonry retaining wall. High winds could uproot the trees causing removal of significant volumes of embankment material. The rust-colored seepage in the vicinity of the downstream toe of the embankment indicates that seepage paths may have developed through the embankment or foundation. Although the condition has remained constant for many years, according to Mr. Dennison, the potential remains for piping of fine-grained soil from the embankment.

#### 6.2 Design and Construction Data

No design and construction data are available according to Mr. Dennison.

#### 6.3 Post Construction Changes

Since the original construction of the dam around 1870, the spillway has been revised three times; in 1880, the masonry portion of the spillway wall was built, in 1890, the present spillway was constructed; and in 1962, the spillway was repaired.

#### 6.4 Seismic Stability

Case Pond Upper Dam is located in Seismic Zone 1 on the "Seismic Zone Map of Contiguous States". Therefore, according to the Recommended Guidelines for Phase I dam inspections, the dam need not be evaluated for seismic stability.

## SECTION 7

### ASSESSMENT, RECOMMENDATIONS AND REMEDIAL MEASURES

#### 7.1 Dam Assessment

a. Condition. The dam is considered to be in poor condition. The following observations help to substantiate this assessment:

1. A significant amount of seepage (about 2 gpm) was observed in the vicinity of the downstream toe of the embankment about 10 feet from the downstream embankment retaining wall.

2. The dam is almost completely overgrown with large trees (up to 3 feet in diameter and 50 feet high) and brush.

3. No means of protecting the upstream face of the dam has been provided.

4. The impoundment cannot be lowered because of the lack of a low level outlet.

5. Leakage is occurring under the spillway wall near the right abutment.

6. Mortar between stones in the retaining wall is cracked or missing.

7. The concrete spillway wall and buttresses are spalled.

b. Adequacy of Information. Sufficient information has been obtained through field observations and through discussions with the Owners to conduct a Phase I dam evaluation.

c. Urgency. The recommendations and remedial measures presented in this Section should be implemented within one year of receipt of this Phase I Inspection Report.

#### 7.2 Recommendations

It is recommended that the Owners retain the services of a qualified, registered professional engineer, experienced in the design and construction of dams, to perform the following services:

1. Investigate the causes of the seepage located in the vicinity of the downstream toe of the embankment (about 10 feet downstream of the retaining wall) and at the base of the spillway wall and assess the need for remedial action at each location.

2. Direct the removal of trees and root systems from the dam and within a 20-foot wide area surrounding the dam. Voids left in the embankment as a result of such removal should be backfilled with suitable thoroughly compacted material.

3. Design a low level outlet for emergency drawdown of the pond.

4. Investigate the abandoned 12-inch diameter pipe to insure that the pipe is not under pressure through the embankment. If the pipe is under pressure, then it should be plugged.

### 7.3 Remedial Measures

a. Operation and Maintenance Procedures. The Owners should also implement the following operation and maintenance procedures:

1. Riprap or other means of protecting the upstream slope of the dam should be provided.

2. All deteriorated concrete and masonry surfaces should be repaired.

3. Cracks between the spillway wall and the rock foundation should be repaired.

4. An ongoing operation and maintenance program should be developed and implemented.

5. A program of annual technical inspection should be instituted.

6. A flood warning plan should be developed so that downstream residents will be notified in the event of possible overtopping and/or failure of the dam.

### 7.4 Alternatives

As an alternative to the above recommendations and remedial measures, the pond could be drained and the dam removed.

APPENDIX A

INSPECTION CHECKLIST

VISUAL INSPECTION CHECK LIST  
INSPECTION TEAM ORGANIZATION

Project: Case Pond Upper Dam  
National I.D. #: CT 00560  
Location: Manchester, Connecticut  
Type of Dam: Earth Embankment/ Masonry  
Inspection Date(s): November 14, 1979  
Weather: Overcast, 40's  
Pool Elevation: 448 ± MSL

Inspection Team

Leonard Beck	O'Brien & Gere	Structures
Steven Snider	O'Brien & Gere	Foundations & Materials
Alan Hanscom	O'Brien & Gere	Structures
Rodney Georges	Bryant & Associates	Hydrology/Hydraulics

\*Mr. John J. Williams, Vice-President, O'Brien & Gere has visited the site but not necessarily in conjunction with the inspection team.

Owner's Representative

Mr. Robert C. Dennison and Mr. Andrew Ansaldi, Co-owners.

\_\_\_\_\_

# VISUAL INSPECTION CHECK LIST

Project: Case Pond Upper Dam

National I.D. #: CT 00560

Date(s): November 14, 1979

AREA EVALUATED	CONDITIONS
<u>DAM EMBANKMENT</u>	
Crest Elevation	450 NGVD
Current Pool Elevation	448 NGVD
Maximum Impoundment to Date	52 Acre-feet
Surface Cracks	None Observed
Pavement Condition	N/A
Movement or Settlement of Crest	None Observed
Lateral Movement	None Observed
Vertical Alignment	No misalignment observed
Horizontal Alignment	No misalignment observed
Condition at Abutment and at Concrete Structures	Slight erosion at spillway abutments
Indications of Movements of Structural Items on Slopes	None Observed
Trespassing on Slopes	Not significant
Vegetation on Slopes	Erosion on u/s face Trees, brush over entire dam
Sloughing or Erosion of Slopes or Abutments	Sloughing on u/s and d/s slopes of eastern portion of embankment
Rock Slope Protection - Riprap Failures	No riprap observed
	A-2

# VISUAL INSPECTION CHECK LIST

Project: Case Pond Upper Dam

National I.D. #: CT 00560

Date(s): November 14, 1979

AREA EVALUATED	CONDITIONS
<u>DAM EMBANKMENT (Con't)</u>	
Unusual Movement or Cracking at or near Toes	None Observed
Unusual Embankment or Downstream Seepage	~1 gpm deep orange - colored seepage ~20 feet d/s of retaining wall
Piping or Boils	Seepage is "boiling"
Foundation Drainage Features	Unknown
Toe Drains	Unknown
Instrumentation System	None
	A-3

# VISUAL INSPECTION CHECK LIST

Project: Case Pond Upper Dam

National I.D. #: CT 00560

Date(s): November 14, 1979

AREA EVALUATED	CONDITIONS
<u>OUTLET WORKS - SPILLWAY WEIR, APPROACH AND DISCHARGE CHANNELS</u>	
a. Approach Channel	
General Condition	Good
Loose Rock Overhanging Channel	None Observed
Trees Overhanging Channel	None Observed
Floor of Approach Channel	Much sediment - several feet per Mr. Dennison
b. Weir and Training Walls	
General Condition of Concrete	Good
Rust or Staining	None Observed
Spalling	d/s side - scattered
Any Visible Reinforcing	None Observed
Any Seepage or Efflorescence	At base of weir wall near western abutment
Drain Holes	None Observed
c. Discharge Channel	
General Condition	Rock ledge - good slope. Not likely to submerge weir.

A-4



## VISUAL INSPECTION CHECK LIST

Project: Case Pond Upper Dam

National I.D. #: CT 00560

Date(s): November 14, 1979

AREA EVALUATED	CONDITIONS
OUTLET WORKS - SPILLWAY WEIR, APPROACH AND DISCHARGE CHANNELS (Con't)	
Loose Rock Overhanging Channel	Not significant
Trees Overhanging Channel	Several in Channel
Floor of Channel	Very rough, ledge and loose stones
Other Obstructions	Trees

APPENDIX B  
ENGINEERING DATA


APPENDIX B  
ENGINEERING DATA\*

TABLE OF CONTENTS

	<u>Page</u>
SITE PLAN	B-1
SPILLWAY PLAN & SECTION	B-2

\*Note: All elevations refer to National Geodetic Vertical Datum (NGVD).

SUBJECT	SHEET	BY	DATE	JOB NO.
Case Pond Upper Dam	B-1	A. H.	3/80	2060-001


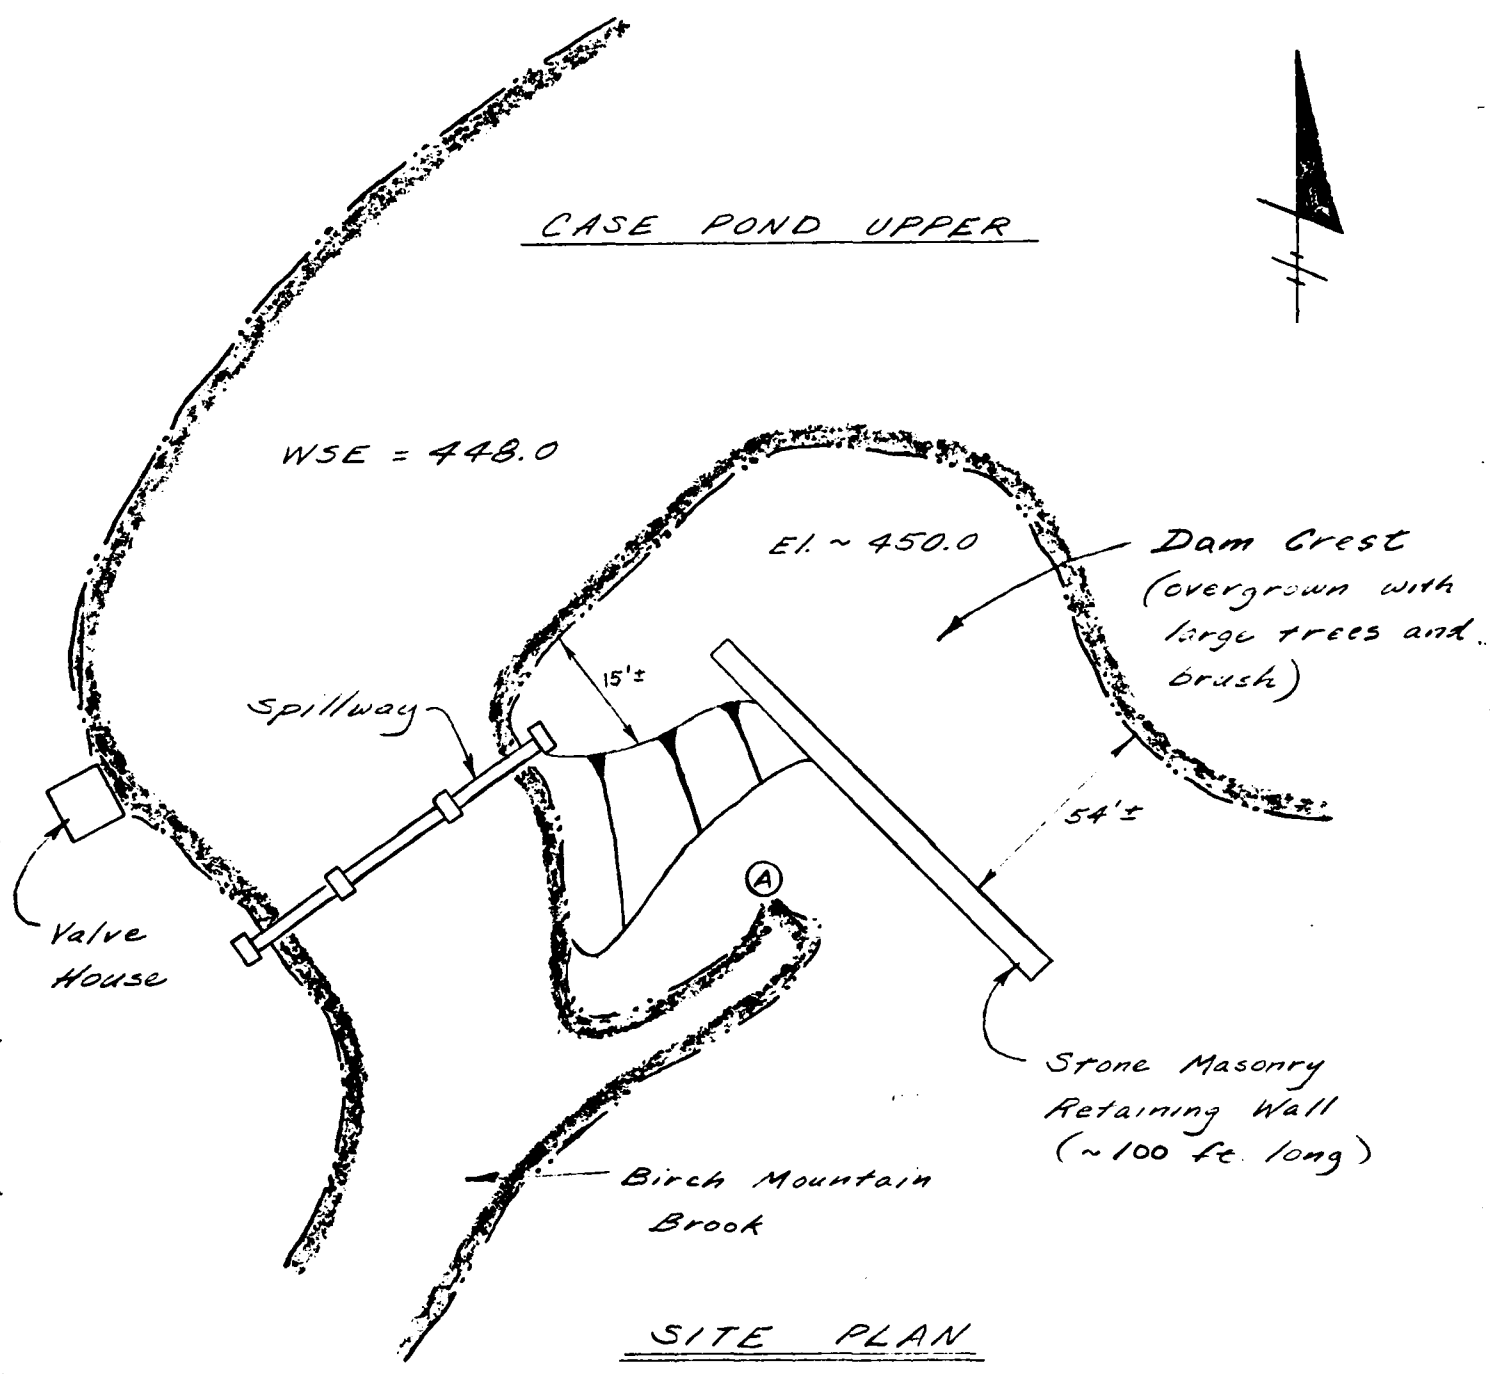


Not To Scale

(A) Approximate location of "boiling" seepage.

SUBJECT	SHEET	BY	DATE	JOB NO
Case Pond Upper Dam	B-2	A. H.	3/80	2060-001

CASE POND UPPER DAM  
FIELD SKETCHES

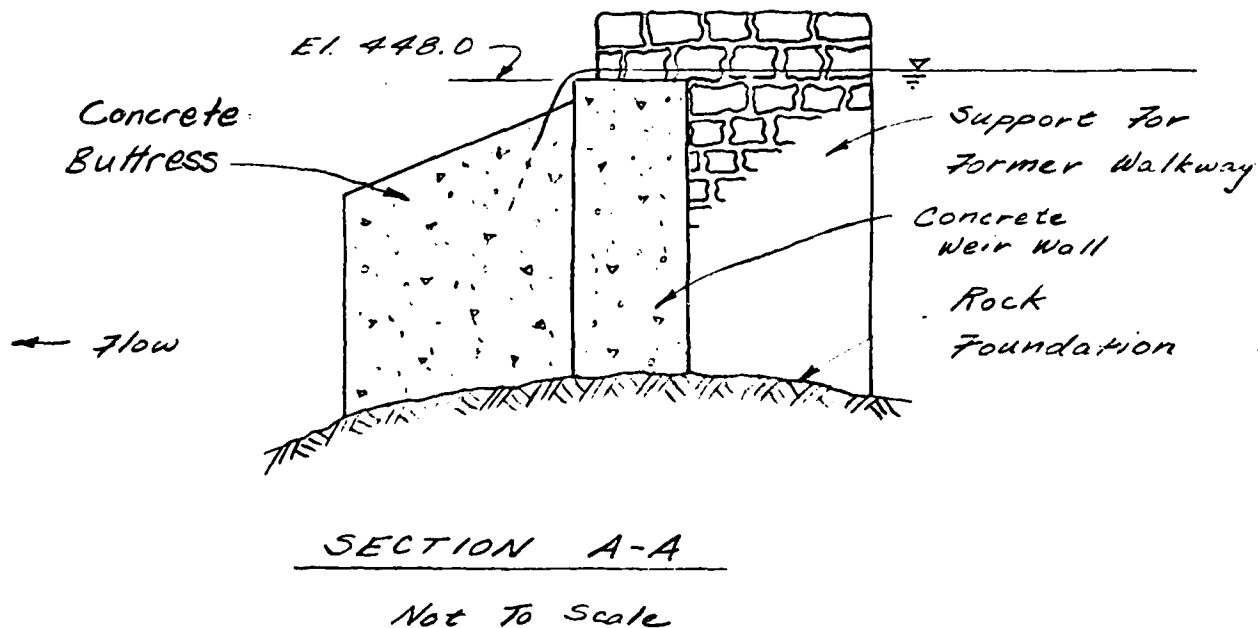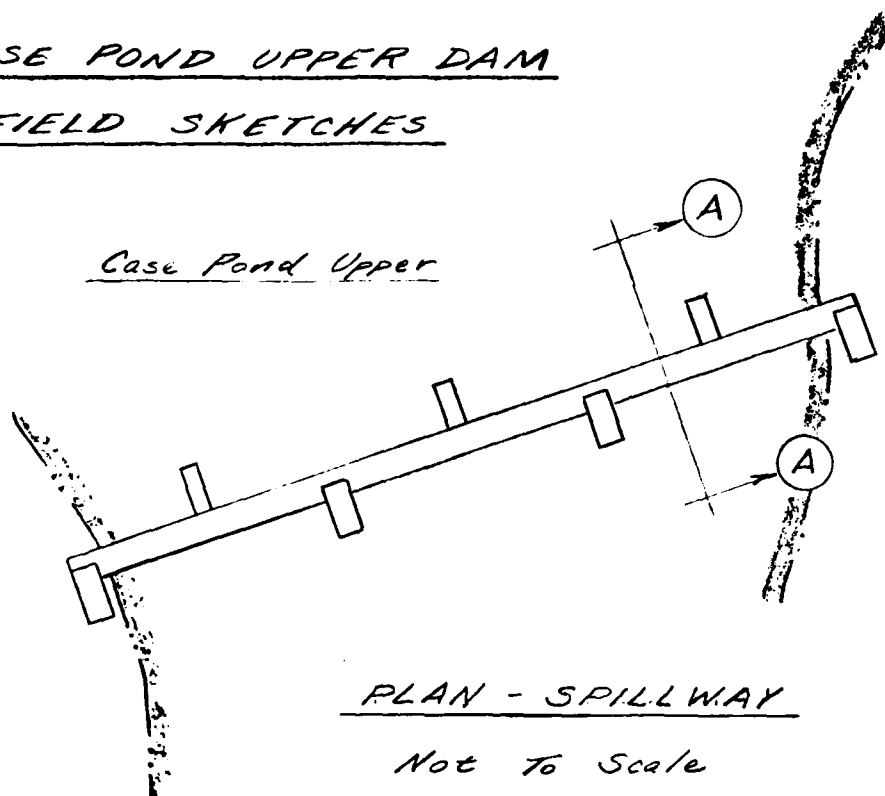

APPENDIX C

PHOTOGRAPHS

APPENDIX C  
SELECTED PHOTOGRAPHS OF PROJECT

LOCATION PLAN

Page  
No.

Site Plan Sketch

A

PHOTOGRAPHS

No.

Page  
No.

- |     |   |   |
|-----|---|---|
| 1.  | Dense tree cover on the downstream face of the dam.   | 1 |
| 2.  | Dense tree cover on the top of the dam looking towards the left abutment.   | 1 |
| 3.  | Vertical downstream masonry wall near the left abutment.  | 2 |
| 4.  | View along the spillway crest looking towards the right abutment.   | 2 |
| 5.  | Seepage through the spillway wall.  | 3 |
| 6.  | Discharge immediately downstream of the spillway.   | 3 |
| 7.  | Seepage which begins about 10 feet downstream of the vertical downstream masonry wall of the dam.                         | 4 |
| 8.  | Seepage flow as viewed from the crest of the downstream vertical masonry wall of the dam.                                 | 4 |
| 9.  | Masonry bridge built over the Case Lower Pond Dam approximately 600 feet downstream of the Case Upper Pond Dam.           | 5 |
| 10. | Discharge over the Case Lower Pond Dam.   | 5 |
| 11. | Region approximately 100 feet upstream of the spillway where water has overtopped the right bank of the pond in the past. | 6 |
| 12. | Region to the right of the Case Lower Pond Dam where discharge would be concentrated during periods of excessive flow.    | 6 |
| 13. | Factory complex about 900 feet downstream of Case Upper Pond Dam.   | 7 |
| 14. | Apartment complex about one mile downstream of Case Upper Pond Dam.   | 7 |

SUBJECT

Case Pond Upper Dam

SHEET

A

BY

A.H.

DATE

4/80

JOB NO

2060-001

CASE POND UPPER

WSE = 448.0 ±

EI. ~ 450.0

Dam Crest  
(overgrown with  
large trees and  
brush)

Spillway

Valve  
House

LOCATION OF  
SEEPAGE AT TOE

Approximate Location  
of Boiling Seepage

Stone Masonry  
Retaining Wall  
(~100 ft. long)

Birch Mountain  
Brook

SITE PLAN

Not To Scale

LEGEND



LOCATION & DIRECTION IN WHICH EACH PHOTO WAS  
TAKEN & THE NUMBER OF THE PHOTO



15' ±

54' ±





1. DENSE TREE COVER ON THE DOWNSTREAM FACE OF THE DAM. (11/14/79)



2. DENSE TREE COVER ON THE TOP OF THE DAM LOOKING TOWARDS THE LEFT ABUTMENT. (11/14/79)



3. VERTICAL DOWNSTREAM MASONRY WALL NEAR THE LEFT ABUTMENT.  
(11/14/79)



4. VIEW ALONG THE SPILLWAY  
CREST LOOKING TOWARDS THE  
RIGHT ABUTMENT. (11/14/79)



5. SEEPAGE THROUGH THE SPILLWAY WALL. (11/14/79)



6. DISCHARGE IMMEDIATELY DOWNSTREAM OF THE SPILLWAY. (11/14/79)



7. SEEPAGE WHICH BEGINS ABOUT 10 FEET DOWNSTREAM OF THE VERTICAL DOWNSTREAM MASONRY WALL OF THE DAM. (11/14/79)



8. SEEPAGE FLOW AS VIEWED FROM THE CREST OF THE DOWNSTREAM VERTICAL MASONRY WALL OF THE DAM. (11/14/79)



9. MASONRY BRIDGE BUILT OVER THE CASE POND LOWER DAM APPROXIMATELY 600 FEET DOWNSTREAM OF THE CASE POND UPPER DAM. (11/14/79)



10. DISCHARGE OVER THE CASE POND LOWER DAM SPILLWAY. (11/14/79)



11. REGION APPROXIMATELY 100 FEET UPSTREAM OF THE SPILLWAY WHERE WATER HAS IN THE PAST OVERTOPPED THE RIGHT BANK OF THE POND. (11/14/79)



12. REGION TO THE RIGHT OF THE CASE POND LOWER DAM WHERE DISCHARGE WOULD BE CONCENTRATED DURING PERIODS OF EXCESSIVE FLOW. (11/14/79)



13. FACTORY COMPLEX ABOUT 900 FEET DOWNSTREAM OF CASE POND  
UPPER DAM. (11/14/79)



14. APARTMENT COMPLEX ABOUT ONE MILE DOWNSTREAM OF CASE POND  
UPPER DAM. (11/14/79)

APPENDIX D


HYDROLOGIC AND HYDRAULIC COMPUTATIONS



# CASE POND UPPER DAM

## APPENDIX D HYDROLOGIC & HYDRAULIC COMPUTATIONS TABLE OF CONTENTS

	PAGE
REGIONAL VICINITY MAP SHOWING FLOOD IMPACT AREA	D-1
DRAINAGE AREA CHARACTERISTICS, $T_p$ COMPUTATIONS, PMP DATA & DAM ELEV., LENGTH & SPWY. DIMENSIONS SKETCH	D-2
STAGE-DISCHARGE & STAGE-STORAGE DATA, CASE PD. UPPER DAM	D-3
STAGE-DISCHARGE & STAGE-STORAGE DATA, CASE PD. LOWER DAM	D-4
DOWNSTREAM CROSS SECTIONS FOR BREACH ROUTING	D-5
STAGE-DISCHARGE & STAGE-STORAGE CURVES, CASE PD. UPPER DAM	D-6
HEC-1 DAM SAFETY VERSION, COMPUTER OUTPUT W/D BREACH	D-7 to D-10
HEC-1 DAM SAFETY VERSION, COMPUTER OUTPUT WITH BREACH	D-11 to D-16

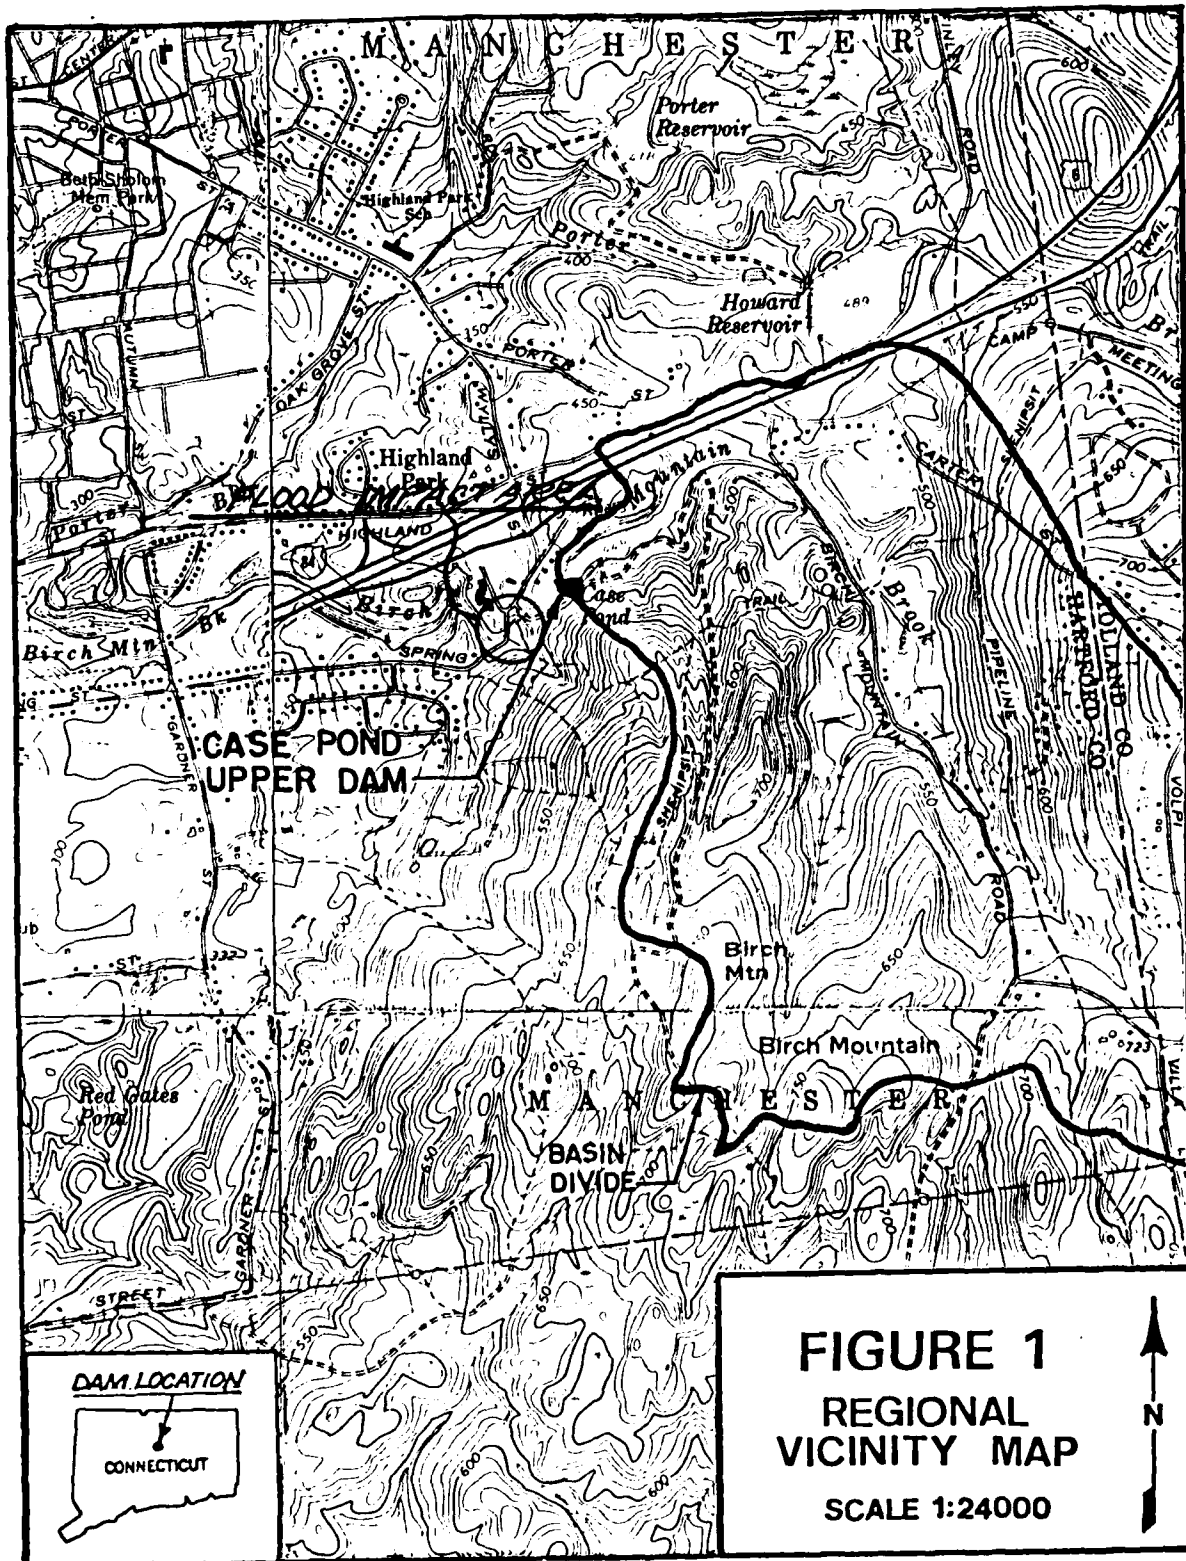

BRYANT ASSOCIATES, INC.  
648 Beacon Street  
BOSTON, MASSACHUSETTS 02215  
(617) 247-1800

JOB 2060-001  
SHEET NO. D-2  
CALCULATED BY R.G.  
CHECKED BY R.R.B.  
OF  
DATE 1/80  
DATE 3/80  
SCALE

# CASE POND UPPER DAM - H & H

1/3

DRAINAGE AREA

= 1.59 sq. Mi.

SNYDER HYDROGRAPH COEFFICIENTS

$C_t = 2.0$

$C_p = 0.5$

## $T_p$ COMPUTATIONS

$L = 2.0$  MILES

$L_{ca} = 1.1$  MILES

$$T_p = C_t \cdot (L \times L_{ca})^{.3}$$

$$T_p = 2 \times (2.0 \times 1.1)^{.3} \approx \underline{\underline{2.50 \text{ HOURS}}}$$

## PMP DATA


FROM HMS #33 THE 24 HOUR 200 sq. Mi INDEX RAINFALL IS 21.5

6hr. % OF INDEX FOR THIS BASIN = 111

12hr. % " " " " " = 124

24hr. % " " " " " = 133

## DAM ELEVATION & LENGTH and SPILLWAY DIMENSIONS SKETCH

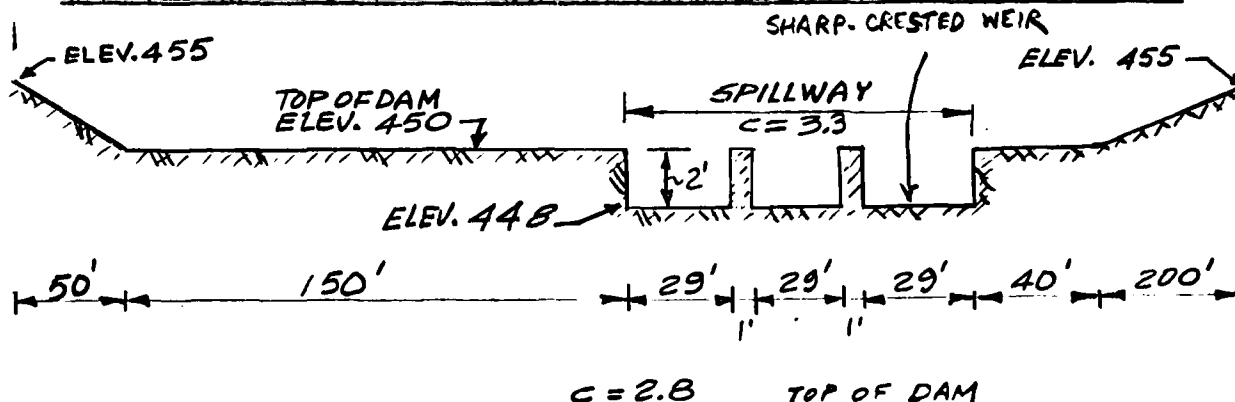

BRYANT ASSOCIATES, INC.  
648 Beacon Street  
BOSTON, MASSACHUSETTS 02215  
(617) 247-1800

JOB 2060.001  
SHEET NO. D-3 OF         
CALCULATED BY R.G. DATE 1/80  
CHECKED BY R.R.B. DATE 3/80  
SCALE       

CASE POND UPPER DAM H&H Cont'd.

2/4

STAGE DISCHARGE

H=0 @ CORRESPONDING CREST

$$Q = CLH^{1.5}$$

SPILLWAY CREST ELEV. = 448 (NGVD)

$Q_1$

C = 3.3

TOP OF DAM ELEV. = 450 (NGVD)

$Q_2$

C = 2.8

ELEVATION (NGVD)	H Ft.	$Q_1$ CFS.	H Ft.	$Q_2$ CFS.	$\Sigma Q$ CFS.
448	0	0			0
449	1	287			287
450	2	812	0	0	812
451	3	1,492	1	553	2,045
452	4	2,297	2	1,638	3,935
453	5	3,210	3	3,154	6,364
454	6	4,219	4	5,086	9,305
455	7	5,317	5	7,437	12,754

STAGE STORAGE

ELEVATION (NGVD)	AREA (AC.)	STORAGE (AC. FT.) (COMP. BY HEC-1 PROGRAM)
433	0	
SPILLWAY CREST 448	5.9	
TOP OF DAM 450	17.5	
460	35.0	

JOB 2060-001

SHEET NO. D-4 OF     

CALCULATED BY R.G. DATE 1/30

CHECKED BY R.R.B. DATE 3/30

SCALE     

3/4

Diagram illustrating the cross-section of a bridge structure with three arches. Key dimensions and labels include:

- Overall width: 600'
- Distance between arch centers: 200'
- Bridge Parapet Elevation: ELEV. 433
- Arch Elevation: ELEV. 430
- Base Elevation: ELEV. 423
- Arch Height: 5'
- Radius of Arch:  $R = 6.06'$
- Area of Arch:  $A = 39.5 \text{ sq. ft.}$
- Centroid location: 2.23' from the base
- Height of Arch:  $H = 0$  @ CORRESPONDING CREST
- Bridge Piers: 200' apart
- Approach Roads: 200' wide

$$\begin{aligned} Q_1 &= C \times S \times L \times H^{1.5} & C &= 3.0 \\ Q_1 &= 5 \times 65 \times A \times \sqrt{2g} \times (H - 2.23)^{1/2} \\ Q_2 &= C L H^{1.5} & C &= 2.8 \\ Q_3 &= C L H^{1.5} & C &= 3.0 \end{aligned}$$

ELEVATION (NGVD)	H <sub>1</sub> FT	Q <sub>1</sub> CFS.	H <sub>2</sub> FT.	Q <sub>2</sub> CFS	H <sub>3</sub> FT.	Q <sub>3</sub> CFS	ΣQ CFS
423	0	0					0
425	2	382					382
426	3	701					701
428	5	1,715					1,509
430	7	2,250	0	0			2,250
433	10	2,872	3	908	0	0	3,780
436	13	3,381	6	5,136	3	1,325	9,842
439	16	3,823	9	15,726	6	3,748	23,297


ELEVATION (NGVD)	AREA (AC.)	SURCHARGE STORAGE (AC.FT.)
NORMAL POOL 423	0.5	
430	1.0	
440	3.6	

SUBJECT	SHEET	BY	DATE	JOB NO.
CASE POND UPPER DAM	D-5	RRR	3/80	2060-001


4/4

DOWNSTREAM CROSS-SECTIONS FOR BREACH ROUTING


CROSS-SECTION AT TOP OF WATERFALL

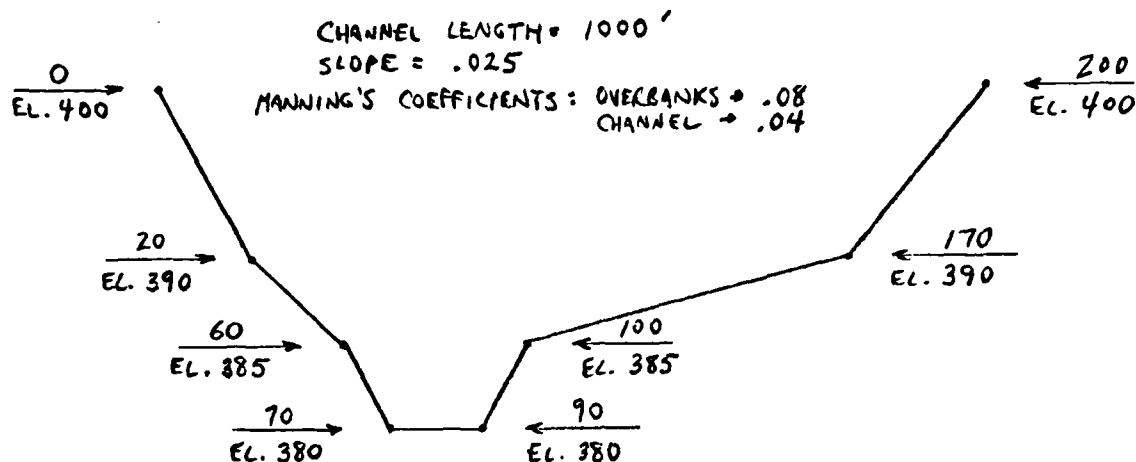

CROSS-SECTION AT BOTTOM OF WATERFALL

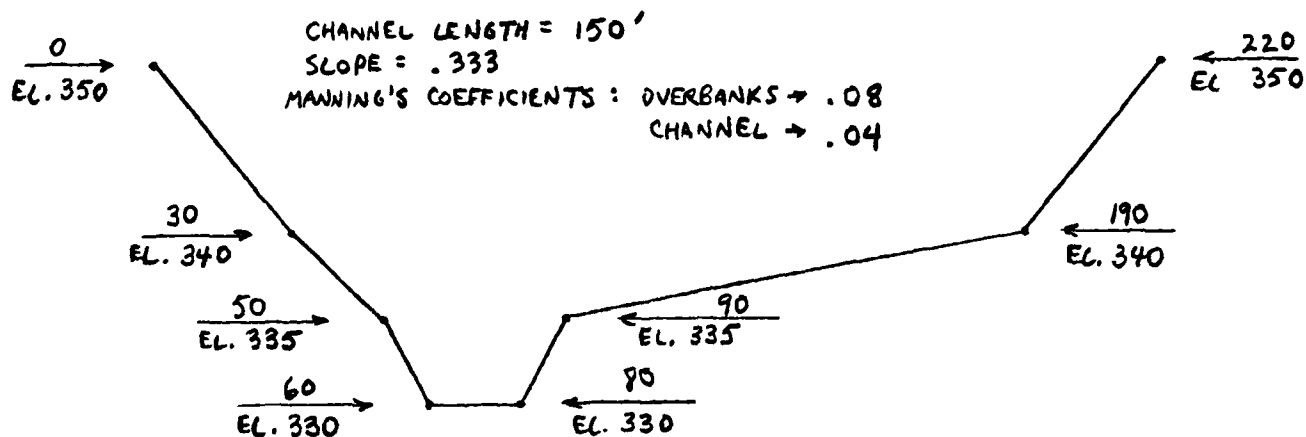

CROSS-SECTION AT HAZARD AREA

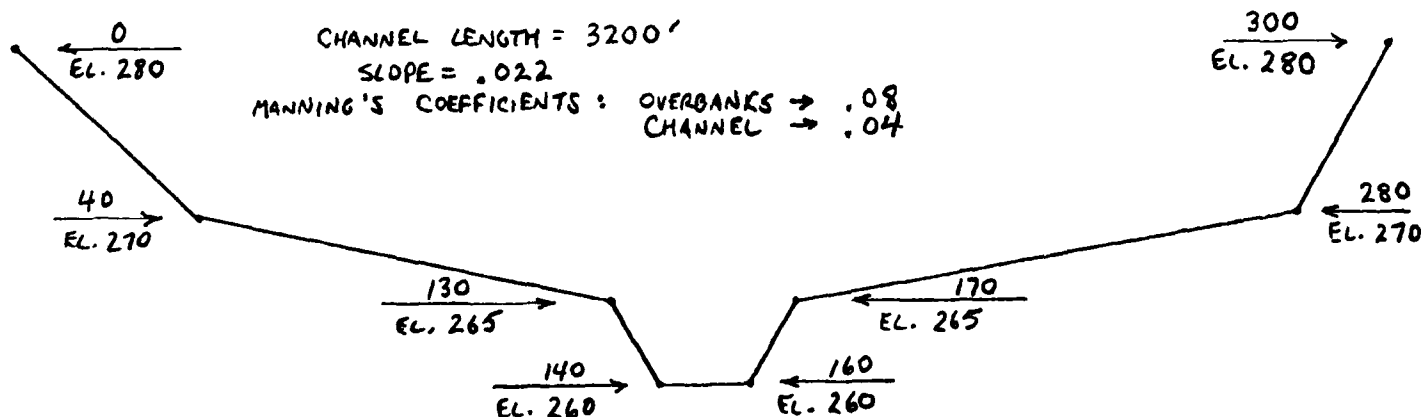



O'BRIEN & GERE  
ENGINEERS, INC.

SUBJECT

CASE POND UPPER DAM

SHEET

D-6

BY

SHS


DATE

3/80

JOB NO

2060-001

STAGE vs. STORAGE  
STAGE vs. DISCHARGE

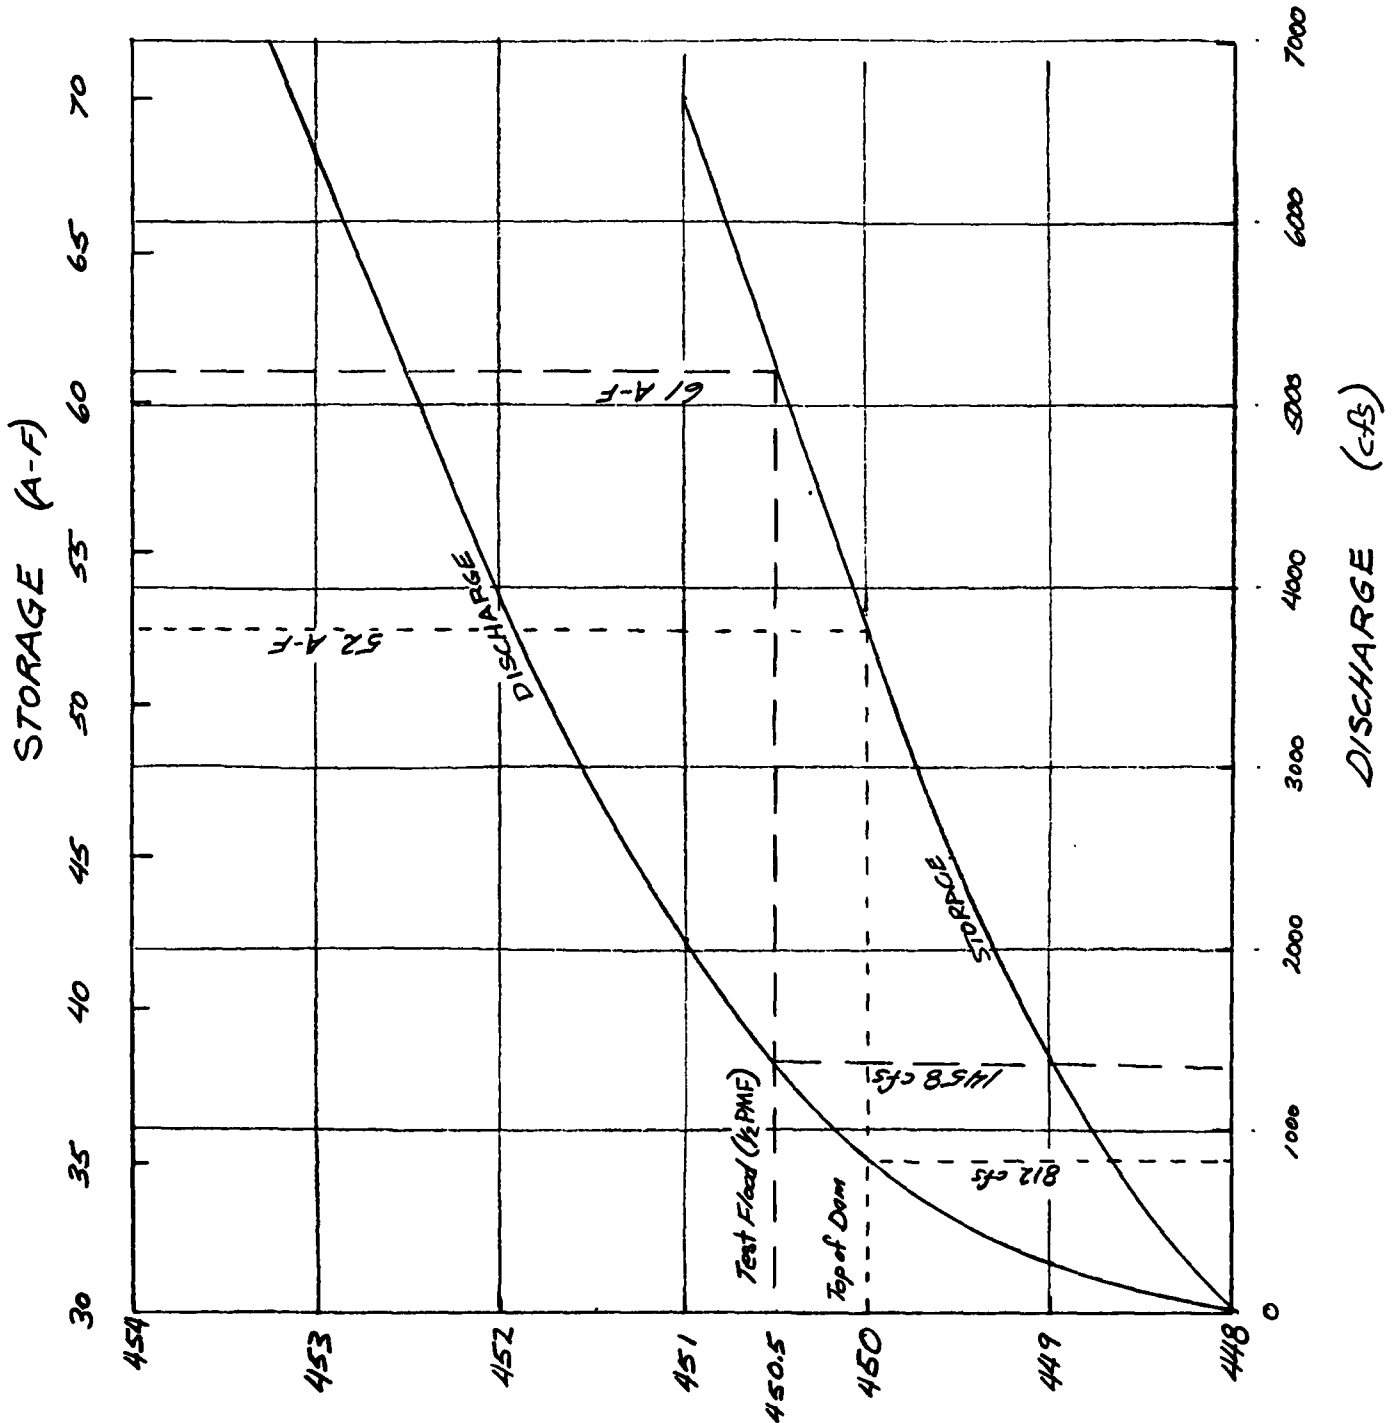





FLOOD HYDROGRAPH PACKAGE (HEC-1)  
DAM SAFETY VERSION JULY 1978  
LAST MODIFICATION 26-FEB-79

RUN-DATED 03/17/80  
TIME 15:21.00

HYDROLOGIC ANALYSIS OF CASE POND UPPER DAM  
NATIONAL DAM INSPECTION PROGRAM  
NEW ENGLAND DIVISION - CORPS OF ENGINEERS

NO NHH NHIN IDAY IMH IMIN METRC IPLT IPRT NSTAN  
300 0 15 0 0 0 0 0 0 -4 0  
JOPER NAT LUPT ITRGE  
5 0 0 0

MULTI-PLAN ANALYSES TO BE PERFORMED  
NPLANE 1 NRTIO= 9 LRTIO= 1

Percentages of PMF → ratios → .20 .30 .40 .50 .60 .70 .80 .90 1.00  
INLOW HYDROGRAPH DEVELOPMENT FOR CASE UPPER POND

SUB-AREA RUNOFF COMPUTATION

INFLOW TO CASE POND UPPER DAM

ISTAQ ICUMP IECON ITAPE JPLT JPRT INAME ISTAGE IAUO  
CAS-U 0 0 0 0 0 0 0 0 0 0

HYDROGRAPH DATA  
IHYDG IUNG TAREA SNAP TRSDA TRSPC RATIO ISNOW ISAME LOCAL  
1 1.59 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00

PRECIP DATA  
SNPFE RMS H6 H12 H24 R48 R72 R96  
0.00 21.50 111.00 124.00 133.00 0.00 0.00 0.00

TRSPC COMPUTED BY THE PROGRAM IS .800

LOSS DATA  
LROPI STRKK ULTKM HTIUL ERAIN STRKS RTIOK STRTL CNSTL ALSMX RTIMP  
0 0.00 0.00 1.00 0.00 0.00 1.00 0.00 0.00 0.05 0.00 0.00

UNIT HYDROGRAPH DATA  
TP= 2.50 CP= .50 NTA= 0

RECESSION DATA  
STAFN= 1.70 QHESM= .10 RTIOM= 2.00

UNIT HYDROGRAPH 78 END-OF-PERIOD ORIGINATES, LAG= 2.52 HOURS, CP= .50 VOL= 1.00  
207. 195. 181. 169. 157. 145. 135. 126. 117. 108. 209.  
101. 94. 81. 75. 65. 60. 56. 52. 27. 25. 13.  
23. 21. 20. 19. 17. 16. 15. 14.

UNITED COMPUTING SYSTEMS, INC.

END-OF-PERIOD FLOW  
MU.DA MH.MN PERIOD RAIN EXCS LUSS COMP Q MD.DA MH.MN PERIOD RAIN EXCS LOSS COMP Q

SUM 22.MA 21.68 1.20 89182.  
( 941.1 ) ( -441.1 ) ( -36.1 ) ( 2525.35 )

~~CONFIDENTIAL~~

## ROUTED OUTFLOW FROM CASE POND UPPER

~~CONFIDENTIAL~~

STAGE	448.00	449.00	450.00	451.00	452.00	453.00	454.00	455.00	Stage - Discharge Data
FLOW	0.00	267.00	812.00	2045.00	3035.00	6344.00	9305.00	12754.00	for Case Upper Bend

[illegible]

ADD 260005-26005

[illegible]

## 04.4 DATA

TOREL	COU9	EXP9	DAMWID
450.0	0.0	0.0	0.

~~0.2 PMF~~  
~~PEAK WUTFLOW IS 570, AT TIME 10.50 HOURS~~

0.3 PMF

6/11 AMC

SMITHSONIAN INSTITUTION  
WASHINGTON, D. C. 20560  
JAN 17 1991  
SI-MNH-1050-1051  
0.4 1/4

0.5 PMF  
PEAK OUTPUT IS 1450, AT TIME 10.50 HOURS

0.6 PMF

PEAK OFFLOW IS 5140.7 MIN 1740.7 AT TIME 14.561 HOURS

**UNITED COMPUTING SYSTEMS, INC.**

0.8 PMF

PEAK OUTFLOW IS 2340. AT TIME 18.25 HOURS

0.9 PMF

PEAK OUTFLOW IS 2632. AT TIME 18.25 HOURS

Two

**ALL INFORMATION CONTAINED  
HEREIN IS UNCLASSIFIED  
DATE 06-18-2009 BY 60321 NLS**

PEAK FLOW AND STORAGE (END OF PERIOD) SUMMARY FOR MULTIPLE PLAN-RATIO-EGRAPHIC COMPUTATIONS  
FLOWS IN CUBIC FEET PER SECOND (CUBIC METERS PER SECOND)  
AREA IN SQUARE MILES (SQUARE KILOMETERS)

OPERATION	STATION	AREA	PLAN	RATIOS APPLIED TO FLOWS									
				RATIO 1	RATIO 2	RATIO 3	RATIO 4	RATIO 5	RATIO 6	RATIO 7	RATIO 8	RATIO 9	
				.20	.30	.40	.50	.60	.70	.80	.90	1.00	
<b>Test Flood Peak Inflow</b>													
HYDROGRAPH AT	CAS-U	1.59 (4.12)	1	587. (16.61)	880. (24.92)	1173. (33.23)	1467. (41.54)	1760. (49.84)	2054. (58.15)	2347. (66.46)	2640. (74.77)	2934. (83.07)	
ROUTED TO	CAS-U	1.59 (4.12)	1	578. (16.37)	874. (24.75)	1166. (33.02)	1458. (41.28)	1749. (49.52)	2040. (57.77)	2340. (66.26)	2632. (74.54)	2924. (82.81)	

↓ Routed Test Flood Outflow

TEST FLOOD RESULTS AT CASE POND UPPER DAM

SUMMARY OF DAM SAFETY ANALYSIS

PLAN 1	INITIAL VALUE	SPILLWAY CREST	TOP OF DAM
ELEVATION	448.00	448.00	450.00
STORAGE	30.	30.	52.
OUTFLOW	0.	0.	842.

RATIO OF PMF	MAXIMUM RESERVOIR W.S.ELEV	MAXIMUM DEPTH OVER DAM	MAXIMUM STORAGE AC-FT	MAXIMUM OUTFLOW CFS	DURATION OVER TOP HOURS	TIME OF MAX OUTFLOW HOURS	TIME OF FAILURE HOURS
.20	449.55	0.00	45.	578.	0.00	18.50	0.00
.30	450.05	.05	53.	874.	1.50	18.50	0.00
.40	451.29	.29	57.	1166.	3.75	18.50	0.00
.50	452.52	.52	61.	1458.	5.00	18.50	0.00
.60	453.76	.76	66.	1749.	6.00	18.50	0.00
.70	454.00	1.00	70.	2040.	6.75	18.50	0.00
.80	451.16	1.16	73.	2340.	7.75	18.25	0.00
.90	451.31	1.31	76.	2632.	8.50	18.25	0.00
1.00	451.47	1.47	79.	2924.	9.25	18.25	0.00

Test Flood Routed Outflow

Test Flood Elevation

CASE UPPER POND DAM BEACH TO PRIMARY HAZARD AREA

HYDROLOGIC ANALYSIS OF CASE POND UPPER DAM  
NATIONAL DAM INSPECTION PROGRAM  
NEW ENGLAND DIVISION - CORPS OF ENGINEERS

0-40005

OUTFLOW FROM CASE POND UPPER

1 1 450 1

450	451	452	453	454	455
812	2045	3935	6364	9305	12754

17.5	35.0
45.0	46.0

004 OCT 4

435 2

~~REMOVING THROUGH~~

—

426 428

701 1509  
3.6

---

\_\_\_\_\_

**ROUTING TO TOP OF**

---

0.08 380  
20 390

~~170-390~~

## ROUTING THROUGH

\_\_\_\_\_

0.08	330
<u>30</u>	<u>340</u>

190 340

~~WEL-HOURLING TO-HA~~

—

260  
270

280 270

\_\_\_\_\_

---

---

1  
2  
3  
4  
5  
6  
7  
8  
9  
10  
11  
12  
13  
14  
15  
16  
17  
18  
19  
20  
21  
22  
23  
24  
25  
26  
27  
28  
29  
30  
31  
32  
33  
34  
35  
36  
37  
38  
39  
40  
41  
42  
43  
44  
45  
46  
47  
48  
49  
50  
51  
52  
53  
54  
55  
56  
57  
58  
59  
60  
61  
62  
63  
64  
65  
66  
67  
68  
69  
70  
71  
72  
73  
74  
75  
76  
77  
78  
79  
80  
81  
82  
83  
84  
85  
86  
87  
88  
89  
90  
91  
92  
93  
94  
95  
96  
97  
98  
99  
100  
101  
102  
103  
104  
105  
106  
107  
108  
109  
110  
111  
112  
113  
114  
115  
116  
117  
118  
119  
120  
121  
122  
123  
124  
125  
126  
127  
128  
129  
130  
131  
132  
133  
134  
135  
136  
137  
138  
139  
140  
141  
142  
143  
144  
145  
146  
147  
148  
149  
150  
151  
152  
153  
154  
155  
156  
157  
158  
159  
160  
161  
162  
163  
164  
165  
166  
167  
168  
169  
170  
171  
172  
173  
174  
175  
176  
177  
178  
179  
180  
181  
182  
183  
184  
185  
186  
187  
188  
189  
190  
191  
192  
193  
194  
195  
196  
197  
198  
199  
200  
201  
202  
203  
204  
205  
206  
207  
208  
209  
210  
211  
212  
213  
214  
215  
216  
217  
218  
219  
220  
221  
222  
223  
224  
225  
226  
227  
228  
229  
230  
231  
232  
233  
234  
235  
236  
237  
238  
239  
240  
241  
242  
243  
244  
245  
246  
247  
248  
249  
250  
251  
252  
253  
254  
255  
256  
257  
258  
259  
260  
261  
262  
263  
264  
265  
266  
267  
268  
269  
270  
271  
272  
273  
274  
275  
276  
277  
278  
279  
280  
281  
282  
283  
284  
285  
286  
287  
288  
289  
290  
291  
292  
293  
294  
295  
296  
297  
298  
299  
300  
301  
302  
303  
304  
305  
306  
307  
308  
309  
310  
311  
312  
313  
314  
315  
316  
317  
318  
319  
320  
321  
322  
323  
324  
325  
326  
327  
328  
329  
330  
331  
332  
333  
334  
335  
336  
337  
338  
339  
340  
341  
342  
343  
344  
345  
346  
347  
348  
349  
350  
351  
352  
353  
354  
355  
356  
357  
358  
359  
360  
361  
362  
363  
364  
365  
366  
367  
368  
369  
370  
371  
372  
373  
374  
375  
376  
377  
378  
379  
380  
381  
382  
383  
384  
385  
386  
387  
388  
389  
390  
391  
392  
393  
394  
395  
396  
397  
398  
399  
400  
401  
402  
403  
404  
405  
406  
407  
408  
409  
410  
411  
412  
413  
414  
415  
416  
417  
418  
419  
420  
421  
422  
423  
424  
425  
426  
427  
428  
429  
430  
431  
432  
433  
434  
435  
436  
437  
438  
439  
440  
441  
442  
443  
444  
445  
446  
447  
448  
449  
450  
451  
452  
453  
454  
455  
456  
457  
458  
459  
460  
461  
462  
463  
464  
465  
466  
467  
468  
469  
470  
471  
472  
473  
474  
475  
476  
477  
478  
479  
480  
481  
482  
483  
484  
485  
486  
487  
488  
489  
490  
491  
492  
493  
494  
495  
496  
497  
498  
499  
500  
501  
502  
503  
504  
505  
506  
507  
508  
509  
510  
511  
512  
513  
514  
515  
516  
517  
518  
519  
520  
521  
522  
523  
524  
525  
526  
527  
528  
529  
530  
531  
532  
533  
534  
535  
536  
537  
538  
539  
540  
541  
542  
543  
544  
545  
546  
547  
548  
549  
550  
551  
552  
553  
554  
555  
556  
557  
558  
559  
560  
561  
562  
563  
564  
565  
566  
567  
568  
569  
570  
571  
572  
573  
574  
575  
576  
577  
578  
579  
580  
581  
582  
583  
584  
585  
586  
587  
588  
589  
590  
591  
592  
593  
594  
595  
596  
597  
598  
599  
600  
601  
602  
603  
604  
605  
606  
607  
608  
609  
610  
611  
612  
613  
614  
615  
616  
617  
618  
619  
620  
621  
622  
623  
624  
625  
626  
627  
628  
629  
630  
631  
632  
633  
634  
635  
636  
637  
638  
639  
640  
641  
642  
643  
644  
645  
646  
647  
648  
649  
650  
651  
652  
653  
654  
655  
656  
657  
658  
659  
660  
661  
662  
663  
664  
665  
666  
667  
668  
669  
670  
671  
672  
673  
674  
675  
676  
677  
678  
679  
680  
681  
682  
683  
684  
685  
686  
687  
688  
689  
690  
691  
692  
693  
694  
695  
696  
697  
698  
699  
700  
701  
702  
703  
704  
705  
706  
707  
708  
709  
710  
711  
712  
713  
714  
715  
716  
717  
718  
719  
720  
721  
722  
723  
724  
725  
726  
727  
728  
729  
730  
731  
732  
733  
734  
735  
736  
737  
738  
739  
740  
741  
742  
743  
744  
745  
746  
747  
748  
749  
750  
751  
752  
753  
754  
755  
756  
757  
758  
759  
760  
761  
762  
763  
764  
765  
766  
767  
768  
769  
770  
771  
772  
773  
774  
775  
776  
777  
778  
779  
780  
781  
782  
783  
784  
785  
786  
787  
788  
789  
790  
791  
792  
793  
794  
795  
796  
797  
798  
799  
800  
801  
802  
803  
804  
805  
806  
807  
808  
809  
810  
811  
812  
813  
814  
815  
816  
817  
818  
819  
820  
821  
822  
823  
824  
825  
826  
827  
828  
829  
830  
831  
832  
833  
834  
835  
836  
837  
838  
839  
840  
84

•

1

**UNITED COMPUTING SYSTEMS, INC.**

D-11

\*\*\*\*\*  
FLOOD HYDROGRAPH PACKAGE (HEC-1)  
DAM SAFETY VERSION JULY 1978  
LAST MODIFICATION 26 FEB 79  
\*\*\*\*\*

RUN DATE=02-17-80  
TIME=15.00.44.

HYDROLOGIC ANALYSIS OF CASE POND UPPER DAM  
NATIONAL DAM INSPECTION PROGRAM  
NEW ENGLAND DIVISION - CORPS OF ENGINEERS

JOB SPECIFICATION  
NQ NHR NMN IDAY IMR IMIN METC IPLT IPRT NSTAN  
300 0 5 0 0 0 0 0 0 -4 0  
JOUR=5 LPORT=0 TRACE=0

MULTI-PLAN ANALYSES TO BE PERFORMED  
NPLAN=1 NRTIO=1 LRTIO=1

NO INFLOW → RTIO= 0.00

HYDROGRAPH ROUTING

ROUTED OUTFLOW FROM CASE POND UPPER

ISTAQ ICOMP IECON ITAPE JPLT JPRT INAME ISTAGE IAUTO  
CAS-U 1 0 0 0 0 0 1 0 0

ROUTING DATA

QLOSS CLOSS AVG IRES ISAME IUPT IPMP LSTR  
0.0 0.000 0.00 1 1 0 0 0

NSTPS NSTDL LAG A4SKK X TSK STORA ISPRAT  
1 0 0 0.000 0.000 0.000 -450. -1

STAGE 449.00 449.00 450.00 451.00 452.00 453.00 454.00  
FLOW 0.00 207.00 412.00 2045.00 3035.00 4364.00 9305.00

455.00 } Stage - Discharge Data  
12754.00 }

SURFACE AREA 0. 6. 18. 35.

CAPACITY 0. 30. 52. 309.

ELEVATION 433. 449. 450. 460.

Stage - Storage Data

Spillway Crest Elevation 449.0  
CREL SPWID CUOW EXPW ELEV COOL CANEA EXPL  
449.0 0.0 0.0 0.0 0.0 0.0 0.0 0.0  
Top of Dam Elevation 450.0  
TOPEL CUOW EXPD DAMWID  
450.0 0.0 0.0 0.

DAM DATA

BRWTD Z DAM-BREACH DATA WSEL FAILEL

Breach Data

UNITED COMPUTING SYSTEMS, INC.

75. .01 435.00 2.00 450.00 450.00

MEGIN DAM FAILING AT 0.00 HOURS

PEAK OUTFLOW IS 412. AT TIME 0.00 HOURS

D-12

# BREACH FLOOD ROUTING THROUGH CASE POND LOWER

## HYDROGRAPH ROUTING

### RESERVOIR ROUTING THROUGH CASE POND LOWER

ISTAO	ICOMP	IECON	ITYPE	JPLT	JPRI	INAME	ISTAGE	IAUTO
CAS-L	1	0	0	0	0	1	0	0
ROUTING DATA								
QLOSS	CLOSS	AVG	IRIS	ISAME	IOPT	IPMP	LSTR	
0.0	0.000	0.00	1	1	0	0	0	
NSTPS NSTUL LAG AWSKK X TSK STORA ISPRAT								
1	0	0	0.000	0.000	0.000	-423.	-1	

STAGE	423.00	425.00	426.00	428.00	430.00	433.00	436.00	439.00
-------	--------	--------	--------	--------	--------	--------	--------	--------

FLOW	0.00	362.00	701.00	1509.00	2250.00	3780.00	9842.00	23297.00
------	------	--------	--------	---------	---------	---------	---------	----------

SURFACE AREA= 1. 1. 4.

CAPACITY= 0. 5. 27.

ELEVATION= 423. 430. 440.

CREL	SPWID	COBW	EXPW	ELEV	COOL	CAREA	EXPL
423.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0

TOPEL CORD EXPD DAMWID  
436.0 0.0 0.0

PEAK OUTFLOW IS 805. AT TIME .00 HOURS

## HYDROGRAPH ROUTING

### CHANNEL ROUTING TO TOP OF WATERFALL

ISTAO	ICOMP	IECON	ITYPE	JPLT	JPRI	INAME	ISTAGE	IAUTO
DS-1	1	0	0	0	0	1	0	0
ROUTING DATA								
QLOSS	CLOSS	AVG	IRIS	ISAME	IOPT	IPMP	LSTR	
0.0	0.000	0.00	1	1	0	0	0	
NSTPS NSTUL LAG AWSKK X TSK STORA ISPRAT								
1	0	0	0.000	0.000	0.000	-1.	0	

# NORMAL DEPTH CHANNEL ROUTING

QM(1) QM(2) QM(3) ELMVT ELMAX RUNTH SEL  
 0000 0000 0000 300.0 400.0 1000 02500

CROSS SECTION COORDINATES--STA+ELEV+STA+ELEV--ETC  
 0.00 400.00 20.00 300.00 60.00 385.00 70.00 380.00 90.00 380.00  
 100.00 385.00 170.00 390.00 200.00 400.00

STORAGE	0.00	16.10	19.93	53	1.17	23.01	1.91	27.01	31.95	2.75	36.21	3.70	40.50	5.09	45.11	7.03	49.75	9.54	54.52	12.61
OUTFLOW	0.00	131.67	433.08	885.08	1742.62	21669.23	885.08	1492.61	25855.37	1492.61	2298.66	3430.48	35286.83	3430.48	4843.88	6587.45	8702.99	6587.45	8702.99	8702.99
STAGE	380.00	381.05	382.11	383.16	384.21	385.26	386.32	387.37	388.42	389.47	390.52	391.57	392.62	393.67	394.72	395.77	396.82	397.87	398.92	399.97
FLUW	0.00	131.67	433.08	885.08	1742.62	21669.23	885.08	1492.61	25855.37	1492.61	2298.66	3430.48	35286.83	3430.48	4843.88	6587.45	8702.99	6587.45	8702.99	8702.99
MAXIMUM STAGE IS	383.0																			

## HYDROGRAPH ROUTING

### CHANNEL ROUTING THROUGH WATERFALL

ISTAT	ICUMP	IECON	ITAPE	IJULT	IPRI	INAME	ISTAGE	IAUTO
DS-2	1	0	0	0	0	1	0	0
ROUTING DATA								
ELUSS	AVG	RES	ITAME	IPMT	IPMP		ISTR	
0.0	0.000	0.00	1	1	0		0	
MSIPS	MSIDL	LAF	ANSKK	TSK	STOMA	ISPRAT		
1	0	0	0.000	0.000	-1.	0		

# NORMAL DEPTH CHANNEL ROUTING

QNT(1) QNT(2) QNT(3) ELNVT ELMAX RLNTH SEL  
.0800 .0400 .0800 330.0 350.0 150. .33300

CROSS SECTION COORDINATES--STA.ELEV.STA.ELEV--ETC  
0.00 350.00 30.00 340.00 50.00 335.00 60.00 330.00 00.00 330.00  
90.00 335.00 190.00 340.00 220.00 350.00

STORAGE 0.00 2.53 3.13 3.76 4.41 5.08 5.77 6.49  
1.07 1.47 1.96  
7.23 7.99 8.78

UNITED COMPUTING SYSTEMS, INC.

OUTFLOW 0.00 480.56 1580.59 3233.54 5447.50 8389.50 12533.91 17744.91 24219.00 32125.03  
41913.63 53578.41 66744.50 81372.06 97435.83 114920.09 133815.75 154118.51 175827.66 198945.29

STAGE 330.00 331.05 332.11 333.16 334.21 335.26 336.32 337.37 338.42 339.47  
340.53 341.58 342.63 343.68 344.74 345.79 346.84 347.89 348.95 350.00

FLOW 0.00 480.56 1580.59 3233.54 5447.50 8389.50 12533.91 17744.91 24219.00 32125.03  
41913.63 53578.41 66744.50 81372.06 97435.83 114920.09 133815.75 154118.51 175827.66 198945.29

MAXIMUM STAGE IS 331.4

## BREACH FLOW ROUTING TO HAZARD AREA

HYDROGRAPH ROUTING

CHANNEL ROUTING TO HAZARD AREA

ISTAQ ICOMP ICON ITAPE JPLT JPRT INAME ISTAGE IAUTO

ROUTING DATA  
ULOSS CLOSS AVG IMFS ISAME IOPT IPMP LSTR

WSTPS NSIDL LAG AMSKK X TSK STORA ISPRAT

# NORMAL DEPTH CHANNEL ROUTING

QNT(1) QNT(2) QNT(3) ELNVT ELMAX RLNTH SEL  
0.0000 0.4000 0.8000 260.0 280.0 320.0 .02200

CROSS SECTION COORDINATES--STA.ELEV.STA.ELEV--ETC  
0.00 280.00 40.00 270.00 130.00 265.00 140.00 260.00 160.00 260.00  
170.00 265.00 280.00 270.00 300.00 280.00

STORAGE 0.00 1.71 3.74 6.10 8.79 11.89 17.43  
71.78 90.93 110.37 130.39 150.90 171.90 193.39

OUTFLOW 0.00 123.52 406.26 831.13 1400.19 2156.78 3250.69  
12176.38 16078.53 20512.44 25477.66 30948.96 36913.80 43362.85

STAGE 260.00 261.05 262.11 263.16 264.21 265.26 266.32  
270.93 271.94 272.63 273.48 274.74 275.79 276.84

FLOW 0.00 123.52 406.26 831.13 1400.19 2156.78 3250.69  
12176.38 16078.53 20512.44 25477.66 30948.96 36913.80 43362.85

MAXIMUM STAGE IS 261.1

Elevation of Breach Floodwaters at Damage Center

Channel Characteristics at Downstream Hazard Center

Streambed Elevation at Hazard Area

26.22 38.27 53.57  
215.37 237.84 260.79  
4700.34 6596.49 9016.70  
50289.12 57687.42 65553.92  
267.37 268.42 269.47  
277.89 278.95 280.00  
4700.34 6596.49 9016.70  
50289.12 57687.42 65553.92



# SUMMARY OF DAM SAFETY ANALYSIS

PLAN 1 \*\*\*\*\*

ELEVATION		INITIAL VALUE	SPILLWAY CREST	TOP OF DAM
STORAGE	450.00	450.00	450.00	450.00
OUTFLOW	52.	30.	52.	52.
		0.	0.	0.

RATIO OF PMF	MAXIMUM DEPTH OVER DAM	MAXIMUM STORAGE AC-FT	MAXIMUM OUTFLOW CFS	DURATION OVER TOP HOURS	TIME OF MAX OUTFLOW HOURS	TIME OF FAILURE HOURS
0.00	449.84	0.00	52.	0.00	0.00	0.00

## CASE UPPER POND BREACH FLOOD RESULTS

# SUMMARY OF DAM SAFETY ANALYSIS

PLAN 1 \*\*\*\*\*

ELEVATION		INITIAL VALUE	SPILLWAY CREST	TOP OF DAM
STORAGE	423.00	423.00	423.00	430.00
OUTFLOW	0.	0.	0.	5.
		0.	0.	2250.

RATIO OF PMF	MAXIMUM DEPTH OVER DAM	MAXIMUM STORAGE AC-FT	MAXIMUM OUTFLOW CFS	DURATION OVER TOP HOURS	TIME OF MAX OUTFLOW HOURS	TIME OF FAILURE HOURS
0.00	426.26	0.00	2.	0.00	0.00	0.00

## PLAN 1 STATION DS-1

RATIO	MAXIMUM FLOW-CFS	MAXIMUM STAGE-FT	TIME HOURS
0.00	805.	383.0	0.00

## PLAN 1 STATION DS-2

RATIO	MAXIMUM FLOW-CFS	MAXIMUM STAGE-FT	TIME HOURS
0.00	805.	331.4	0.00

## PLAN 1 STATION DS-3

RATIO	MAXIMUM FLOW-CFS	MAXIMUM STAGE-FT	TIME HOURS
0.00	805.	263.1	0.00

Peak Breach Flow at Damage Center

UNITED COMPUTING SYSTEMS, INC.

D-16

APPENDIX E

INFORMATION AS CONTAINED IN THE NATIONAL INVENTORY OF DAMS

The above statement means that Appendix E is  
not available per Mr. Tim Hayes, Army Corps  
of Engineers, New England Division

END

FILMED

9-84

DTIC